

**Electricity and New Energy**

# **Motor Drives**

**Courseware Sample**

52732-F0

Order no.: 52732-10  
First Edition  
Revision level: 07/2016

By the staff of Festo Didactic

© Festo Didactic Ltée/Ltd, Quebec, Canada 2016  
Internet: [www.festo-didactic.com](http://www.festo-didactic.com)  
e-mail: [did@de.festo.com](mailto:did@de.festo.com)

Printed in Canada  
All rights reserved

ISBN 978-2-89747-702-8 (Printed version)  
ISBN 978-2-89747-703-5 (CD-ROM)

Legal Deposit – Bibliothèque et Archives nationales du Québec, 2016  
Legal Deposit – Library and Archives Canada, 2016

The purchaser shall receive a single right of use which is non-exclusive, non-time-limited and limited geographically to use at the purchaser's site/location as follows.

The purchaser shall be entitled to use the work to train his/her staff at the purchaser's site/location and shall also be entitled to use parts of the copyright material as the basis for the production of his/her own training documentation for the training of his/her staff at the purchaser's site/location with acknowledgement of source and to make copies for this purpose. In the case of schools/technical colleges, training centers, and universities, the right of use shall also include use by school and college students and trainees at the purchaser's site/location for teaching purposes.

The right of use shall in all cases exclude the right to publish the copyright material or to make this available for use on intranet, Internet and LMS platforms and databases such as Moodle, which allow access by a wide variety of users, including those outside of the purchaser's site/location.

Entitlement to other rights relating to reproductions, copies, adaptations, translations, microfilming and transfer to and storage and processing in electronic systems, no matter whether in whole or in part, shall require the prior consent of Festo Didactic.















 
 
Information in this document is subject to change without notice and does not represent a commitment on the part of Festo Didactic. The Festo materials described in this document are furnished under a license agreement or a nondisclosure agreement.

Festo Didactic recognizes product names as trademarks or registered trademarks of their respective holders.









All other trademarks are the property of their respective owners. Other trademarks and trade names may be used in this document to refer to either the entity claiming the marks and names or their products. Festo Didactic disclaims any proprietary interest in trademarks and trade names other than its own.

# Safety and Common Symbols

The following safety and common symbols may be used in this manual and on the equipment:

Symbol	Description
	<b>DANGER</b> indicates a hazard with a high level of risk which, if not avoided, will result in death or serious injury.
	<b>WARNING</b> indicates a hazard with a medium level of risk which, if not avoided, could result in death or serious injury.
	<b>CAUTION</b> indicates a hazard with a low level of risk which, if not avoided, could result in minor or moderate injury.
	<b>CAUTION</b> used without the <i>Caution, risk of danger</i> sign  , indicates a hazard with a potentially hazardous situation which, if not avoided, may result in property damage.
	Caution, risk of electric shock
	Caution, hot surface
	Caution, risk of danger
	Caution, lifting hazard
	Caution, hand entanglement hazard
	Notice, non-ionizing radiation
	Direct current
	Alternating current
	Both direct and alternating current
	Three-phase alternating current
	Earth (ground) terminal

# Safety and Common Symbols

Symbol	Description
	Protective conductor terminal
	Frame or chassis terminal
	Equipotentiality
	On (supply)
	Off (supply)
	Equipment protected throughout by double insulation or reinforced insulation
	In position of a bi-stable push control
	Out position of a bi-stable push control

# Table of Contents

Preface .....	IX
About This Manual .....	XI
To the Instructor .....	XIII
<b>Unit 1</b>	
<b>AC Drives.....</b>	<b>1</b>
DISCUSSION OF FUNDAMENTALS.....	1
Motor speed .....	2
<b>Ex. 1-1</b>	
<b>AC Drive Overview .....</b>	<b>3</b>
DISCUSSION .....	3
Keypad .....	4
Input and output terminals .....	5
Microswitches.....	5
Parameters.....	6
Setting the value of a parameter .....	8
Reading the current setting of a parameter .....	8
Quick parameter selection .....	8
Initialization procedure .....	9
PROCEDURE .....	11
Set up and connections .....	11
Parameter settings .....	11
Initialization procedure .....	12
Basic motor control functions.....	13
Quick parameter selection .....	15
<b>Ex. 1-2</b>	
<b>Volts per Hertz Characteristics .....</b>	<b>17</b>
DISCUSSION .....	17
Direction of rotation .....	17
V/f characteristic.....	17
Frequency reference selection.....	18
PROCEDURE .....	19
Set up and connections .....	19
Direction of rotation .....	20
V/f characteristic.....	22
<b>Ex. 1-3</b>	
<b>Ramp and Torque Boost.....</b>	<b>29</b>
DISCUSSION .....	29
Acceleration and deceleration times .....	29
Acceleration and deceleration patterns.....	30
Torque boost .....	31

# Table of Contents

	PROCEDURE .....	32
	Set up and connections.....	32
	Acceleration and deceleration ramps.....	32
	Acceleration characteristic .....	34
	Torque boost .....	38
<b>Ex. 1-4</b>	<b>Protection .....</b>	<b>45</b>
	DISCUSSION .....	45
	Limiting motor current .....	45
	Overload alarm signal .....	47
	Overvoltage during deceleration .....	47
	Multi-function output.....	47
	PROCEDURE .....	49
	Set up and connections.....	49
	Limiting motor current .....	49
	Overload alarm signal .....	53
	Overvoltage during deceleration .....	54
<b>Ex. 1-5</b>	<b>Braking and Jogging .....</b>	<b>57</b>
	DISCUSSION .....	57
	DC braking .....	57
	Jog mode .....	58
	Multi-function inputs .....	59
	PROCEDURE .....	60
	Set up and connections.....	60
	DC braking .....	60
	Jog mode .....	62
<b>Ex. 1-6</b>	<b>Remote Controls .....</b>	<b>67</b>
	DISCUSSION .....	67
	Introduction .....	67
	PROCEDURE .....	67
	Set up and connections.....	67
	Project description.....	68
	Tips.....	68
	Equipment selection.....	69
	Schematic diagram of the circuit.....	71
	Circuit setup .....	72
	AC Drive parameter values .....	73
	Circuit approval .....	73

# Table of Contents

<b>Unit 2</b>	<b>DC Drives.....</b>	<b>79</b>
	DISCUSSION .....	79
	Introduction .....	79
<b>Ex. 2-1</b>	<b>DC Drive Overview .....</b>	<b>81</b>
	DISCUSSION .....	81
	Input and output terminals .....	82
	Parameters.....	82
	Minimum speed.....	83
	Maximum speed.....	83
	PROCEDURE .....	83
	Set up and connections .....	83
	Minimum speed.....	85
	Maximum speed.....	85
	Speed versus voltage characteristic .....	86
	Additional speed settings .....	88
	Direction of rotation .....	88
<b>Ex. 2-2</b>	<b>Current Limiting and IR Compensation .....</b>	<b>91</b>
	DISCUSSION .....	91
	Current limiting .....	91
	IR compensation .....	91
	PROCEDURE .....	92
	Set up and connections .....	92
	Current limiting .....	93
	IR compensation .....	94
<b>Appendix A</b>	<b>Equipment Utilization Chart .....</b>	<b>99</b>
<b>Appendix B</b>	<b>Diagram Symbols .....</b>	<b>101</b>
<b>Appendix C</b>	<b>Setup Procedures.....</b>	<b>103</b>
	Module installation procedure .....	103
	Energizing procedure .....	103
	Module identification .....	104
<b>Appendix D</b>	<b>AC Drive – Error Codes and Parameter Numbers.....</b>	<b>105</b>
<b>Appendix E</b>	<b>DC Motor Characteristics .....</b>	<b>143</b>
	Bibliography .....	145

# Preface

The Motor Drives Training System (Add-On to Models 8001 or 8006), model 8036-B, introduces the use of the AC and DC drives to control electric motors.

We hope that your learning experience will be the first step of a successful career.

We invite readers of this manual to send us their tips, feedback, and suggestions for improving the book.

Please send these to [did@de.festo.com](mailto:did@de.festo.com).

The authors and Festo Didactic look forward to your comments.





# About This Manual

## Manual objectives

The exercises in this manual, Motor Drives, provide the knowledge necessary to perform motor controls with the help of motor drives.

The present manual is divided into two units:

- Unit 1 introduces the AC Drive and its main functions;
- Unit 2 introduces the DC Drive and its main functions.

Each unit contains exercises which provide a systematic and realistic means of learning the subject matter. Each exercise is divided into the following sections:

- A clearly defined Exercise Objective;
- A Discussion of the theory involved in the exercise;
- A Procedure Summary which provides a bridge between the theoretical Discussion and the laboratory Procedure;
- A step-by-step laboratory Procedure in which the students observe and quantify important principles covered in the Discussion;
- A Conclusion to summarize the material presented in the exercise;
- Review Questions to verify that the material has been well assimilated.

A ten-question test at the end of each unit allows the student's knowledge of the unit material to be assessed.

## Safety considerations

Safety symbols that may be used in this manual and on the equipment are listed in the Safety Symbols table at the beginning of the manual.

Safety procedures related to the tasks that you will be asked to perform are indicated in each exercise.

Make sure that you are wearing appropriate protective equipment when performing the tasks. You should never perform a task if you have any reason to think that a manipulation could be dangerous for you or your teammates.

## Prerequisite

Before performing an exercise, you should read the pages of the AC Drive or DC Drive user manuals that deal with the covered topics. Ask your instructor for a copy, or download the file from the manufacturer's website.

## Systems of units

Units are expressed using the International System of Units (SI) followed by units expressed in the U.S. customary system of units (between parentheses).



# To the Instructor

You will find in this Instructor Guide all the elements included in the Student Manual together with the answers to all questions, results of measurements, graphs, explanations, suggestions, and, in some cases, instructions to help you guide the students through their learning process. All the information that applies to you is placed between markers and appears in red.

## **Accuracy of measurements**

The numerical results of the hands-on exercises may differ from one student to another. For this reason, the results and answers given in this manual should be considered as a guide. Students who correctly performed the exercises should expect to demonstrate the principles involved and make observations and measurements similar to those given as answers.

## **Notes to the instructor**

- Before a student begins an exercise, ensure that the equipment is in good condition and does not represent any risk when used.
- This guide provides you with the answers to questions.
- Make sure that the students understand the objectives of the work to do.
- The default setting of some parameters depends on the Country parameter of the AC Drive. For this reason, the default setting values shown in the user guide may differ from the current default settings of the AC Drive.
- If the AC Drive OMRON is displaying error E12 even if nothing is connected to the Multi-function inputs, one of the Multi-function inputs is configured for a low-level signal (like the normally closed contact of the Emergency Button). To clear error E12, you must apply 24 V dc on this input and press the STOP/RESET button. If you do not know which input is configured that way, apply 24 V dc (from terminal P24) to input S1 and try to clear the error. If it does not work, try again with input S2, S3, S4, S5, S6 and S7. Once the error is cleared, initialize the AC Drive by performing the Initialization procedure shown in the student manual.



**Sample Exercise**  
**Extracted from**  
**the Student Manual**  
**and the Instructor Guide**



## Ramp and Torque Boost

### EXERCISE OBJECTIVE

The exercise objectives are listed below:

- Understand the acceleration and deceleration time settings.
- Introduce the linear and S-shape acceleration and deceleration patterns.
- Introduce the Torque boost function.

### DISCUSSION OUTLINE

The Discussion of this exercise covers the following points:

- Acceleration and deceleration times
- Acceleration and deceleration patterns
- Torque boost

### DISCUSSION

#### Acceleration and deceleration times

The acceleration time defines the time duration in which the AC Drive reaches its maximum frequency after a start signal is issued. Short acceleration times are usually for light loads, and long acceleration times for heavy loads, or in applications requiring soft start such as a bottle conveyor. The Acceleration time function is also known as ramping. See Figure 1-10.

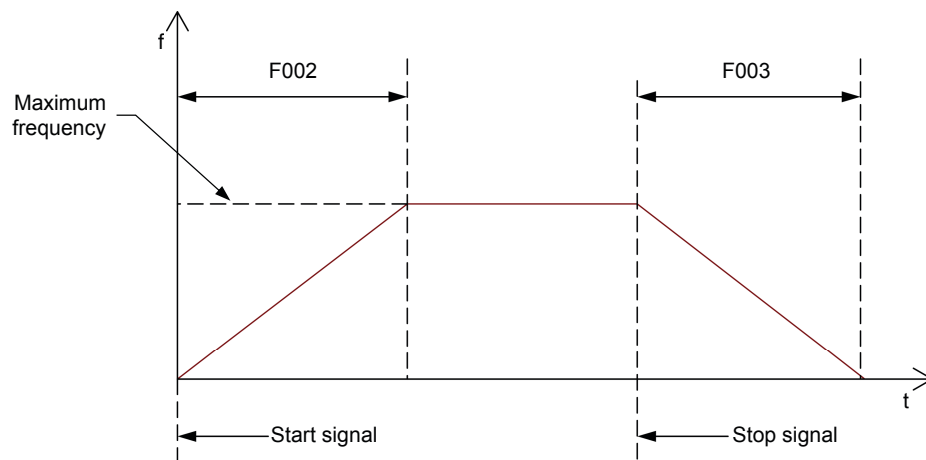


Figure 1-10. Acceleration/deceleration ramps.

Conversely, the deceleration time defines the time duration in which the AC Drive reduces the output frequency from the maximum frequency to 0 Hz after a stop signal. If the equipment connected to a motor has low friction and a lot of inertia, it could coast for a long time. The Deceleration time function allows the load to be stopped more quickly.



The *Acceleration time setting* and *Deceleration time setting* functions are set using parameters F002 and F003. The characteristics of these parameters are shown in Table 1-10.

Table 1-10. Characteristics of parameters F002, F003, A097, A098, and b082.

Parameter	Function	Value	DS
F002	<i>Acceleration time setting</i>	0.01 to 3600 s	10.00
F003	<i>Deceleration time setting</i>	0.01 to 3600 s	10.00
A097	<i>Acceleration pattern selection</i>	00: Linear 01: S-shape curve 02: U shape 03: Reverse-U shape 04: EL-S shape	01
A098	<i>Deceleration pattern selection</i>	00: Linear 01: S-shape curve 02: U shape 03: Reverse-U shape 04: EL-S shape	01
b082*	<i>Starting frequency</i>	0.01 to 9.99	1.5

\* Parameter b082 directly affects real acceleration/deceleration times. In order to actually obtain the time values set to F002 and F003, the starting frequency must be set to its lowest value.

### Acceleration and deceleration patterns

The acceleration and deceleration patterns can be linear or S shape. When a motor is started or stopped using the linear acceleration or deceleration patterns, its rate of change until it reaches full speed, or comes to a complete stop, is linear. See Figure 1-11.

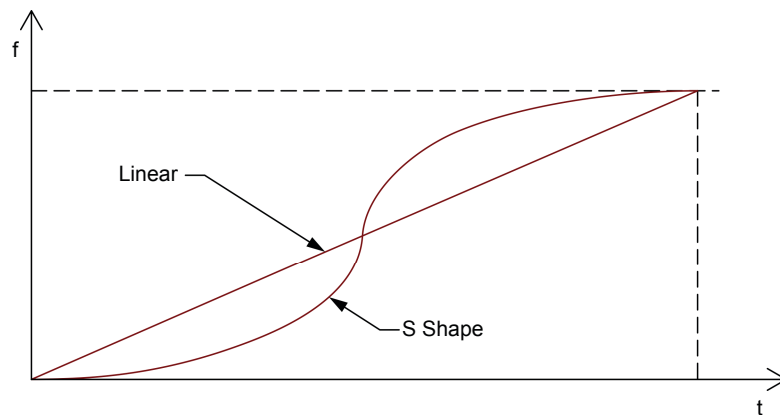


Figure 1-11. Linear and S-shape patterns during acceleration.

When the motor is started or stopped, using the S-shape acceleration or deceleration pattern, its rate of change gradually increases or decreases until it reaches full speed, or comes to a complete stop. The purpose of the S-shape pattern is to combine soft starts and soft stops with high speeds between them.

The movement of an elevator is an example of the S-shape acceleration/deceleration pattern.

The *Acceleration pattern selection* and *Deceleration pattern selection* functions are set using parameters A097 and A098. The characteristics of these parameters are shown in Table 1-10.

### Torque boost

If the mass inertia moment or static friction of the connected load is high, it may be necessary to increase (boost) the output voltage beyond the normal V/f characteristics at low output frequencies. This compensates for the voltage drop in the motor windings and can be up to half the motor's nominal voltage.

The torque boost (voltage increase) is defined as a percentage value. As Figure 1-12 shows, the Manual torque boost voltage function (parameter A042) is a percentage of the output voltage and the Manual torque boost frequency function (A043) is a percentage of the frequency.

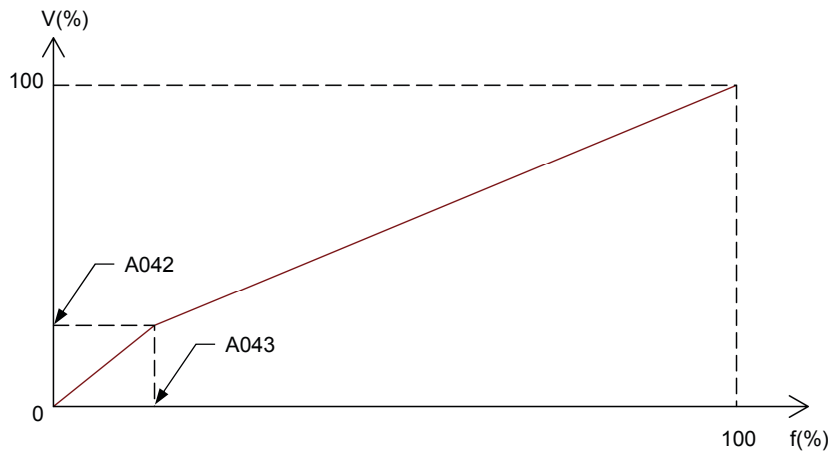


Figure 1-12. Torque boost.

The Torque boost selection function (parameter A041) lets you select between manual and automatic torque boost. Automatic torque boost is added to the V/f characteristics depending on the current load.

The torque boost functions are set using parameters A041, A042 and A043. The characteristics of these parameters are shown in Table 1-11.

Table 1-11. Characteristics of parameters A041, A042, and A043.

Parameter	Function	Value	DS
A041	<i>Torque boost selection</i>	00: Manual 01: Automatic	01
A042	<i>Manual torque boost voltage</i>	0 to 20 % of output voltage	1.0
A043	<i>Manual torque boost frequency</i>	0 to 50 % of base frequency	5.0

**PROCEDURE OUTLINE**

The Procedure is divided into the following sections:

- Set up and connections
- Acceleration and deceleration ramps
- Acceleration characteristic
- Torque boost

**PROCEDURE**

**Set up and connections**

*In this section, you will setup the AC Drive.*



The Power Supply provides high voltages. Do not change any AC connection with the power on.

1. Set up the circuit shown in Figure 1-8.

**Acceleration and deceleration ramps**

*In this section, you will familiarize yourself with the setting of the acceleration and deceleration times.*

2. Connect a voltmeter between terminals FV and SC on the AC Drive.

Perform the Energizing procedure.

Turn on the Power Supply and set the voltage control knob to 100%.

3. Set the parameters of the AC Drive as follows:

- Restore the default setting of the parameters and configure the AC Drive according to the ratings of the Four-Pole Squirrel-Cage Induction Motor by performing the Initialization procedure;
- Select *Control circuit terminal block* as *Frequency reference selection* function by setting parameter A001 to 01;
- Set the *Starting frequency* to 0.01 Hz by setting parameter b082 to 0.01;
- Set the AC Drive to display the output voltage by selecting parameter d013.

4. On the DC Drive, set the remote potentiometer to obtain 10.0 V dc on the voltmeter display.

Determine the acceleration time by starting a chronometer as you set the AC Drive to the run mode, and stopping it when the data display indicates the maximum output voltage for your network (200 V, 380 V or 415 V depending on your local network). Repeat the measurement to validate your result.

Acceleration time = \_\_\_\_\_

10 s

5. Does this correspond to the default setting of the *Acceleration time setting* function (parameter F002)?

Yes     No

Yes

6. Set the AC Drive to the run mode and wait for the motor to attain maximum speed.

Determine the deceleration time by starting a chronometer as you set the AC Drive to the stop mode, and stopping it when the data display indicates 0 V. Repeat the measurement to validate your result.

Deceleration time = \_\_\_\_\_

10 s

7. Does this correspond to the default setting of the *Deceleration time setting* (F003)?

Yes     No

Yes

8. Familiarize yourself with the setting of acceleration and deceleration times by setting a 20.00 s acceleration time and a 15.00 s deceleration time.

Test the operation of your circuit.

9. Turn off the Power Supply.

### Acceleration characteristic


In this section, you will plot the linear and S-shape acceleration patterns.

- Couple the dynamometer with the Four-Pole Squirrel-Cage Induction Motor using a Timing Belt.



Depending on which training system you are using, your dynamometer is either the Four-Quadrant Dynamometer/Power Supply, Model 8960-B, the Prime Mover / Dynamometer, Model 8960-1, or the Electrodynamometer, Model 8911.

Turn the load control knob on the dynamometer fully CCW (min load).

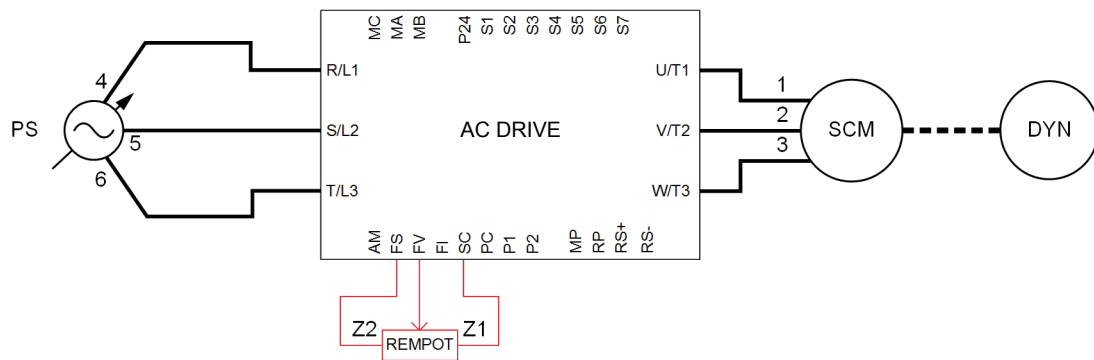

- Legend**
- AC DRIVE = Three-phase ac drive
  - DYN = Dynamometer
  - REMPOT = Remote potentiometer (dc drive potentiometer)
  - SCM = Four-pole squirrel-cage motor
  - PS = Power supply

Figure 1-13. Couple a dynamometer with the Four-Pole Squirrel-Cage Induction Motor.

- Turn on the Power Supply and set the voltage control knob to 100%.

On the DC Drive, set the remote potentiometer to obtain 10.0 V dc on the voltmeter display.

Set the *Acceleration time setting* to 30 s by setting parameter F002 to 30.00.

Set the *Acceleration pattern selection* function to Linear by setting parameter A097 to 00.

Select parameter d001 to display the output frequency.

12. Set the AC Drive to the run mode and wait for the motor to run at full speed (30 s).

Set the load control knob on the dynamometer to 1 N·m (9 lbf·in).



*This setting is required to apply a predetermined load to the Four-Pole Squirrel-Cage Induction Motor.*

Set the AC Drive to the stop mode.

13. Measure the time taken by the AC Drive to attain 10 Hz by starting the chronometer as you set the AC Drive to the run mode, and stopping it when the AC Drive indicates 10 Hz. Repeat the measurement to validate your result.

Enter your result in the appropriate cell in the Linear column in Table 1-12.

Set the AC Drive to the stop mode.

**Table 1-12. Linear and S-shape acceleration patterns.**

Frequency range	Time (s)	
	Acceleration pattern	
	Linear	S-shape
0 to 10 Hz		
0 to 20 Hz		
0 to 30 Hz		
0 to 40 Hz		
0 to 50 Hz		
0 to 60 Hz (if applicable)		

**Linear and S-shape acceleration patterns (120 V – 60 Hz network).**

Frequency range	Time (s)	
	Acceleration pattern	
	Linear	S-shape
0 to 10 Hz	5.0	7.2
0 to 20 Hz	10.0	11.5
0 to 30 Hz	15.0	15.0
0 to 40 Hz	20.0	18.6
0 to 50 Hz	25.0	22.9
0 to 60 Hz	30.0	30.0

Linear and S-shape acceleration patterns (220/240 V – 50 Hz network).

Frequency range	Time (s)	
	Acceleration pattern	
	Linear	S-shape
0 to 10 Hz	6.0	8.2
0 to 20 Hz	12.0	13.0
0 to 30 Hz	18.0	17.2
0 to 40 Hz	24.0	22.0
0 to 50 Hz	30.0	30.0

Linear and S-shape acceleration patterns (220 V – 60 Hz network).

Frequency range	Time (s)	
	Acceleration pattern	
	Linear	S-shape
0 to 10 Hz	5.0	7.2
0 to 20 Hz	10.0	11.5
0 to 30 Hz	15.0	15.0
0 to 40 Hz	20.0	18.6
0 to 50 Hz	25.0	22.9
0 to 60 Hz	30.0	30.0

14. Repeat the previous measurement for all frequency ranges shown in Table 1-12.

Enter your results in the appropriate cells in the Linear column in Table 1-12.

15. Set the AC Drive to the stop mode.

Set the *Acceleration pattern selection* function (A097) to 01 to select the S-shape acceleration pattern.

Select parameter d001 to display the output frequency.

16. Repeat the measurements to fill out the empty cells of Table 1-12 with the S-shape acceleration pattern.

17. Set the AC Drive to the stop mode.

18. Plot the curves showing the linear and S-shape acceleration patterns in Figure 1-14. Place the Time values along the X-axis, and the Frequency values along the Y-axis.

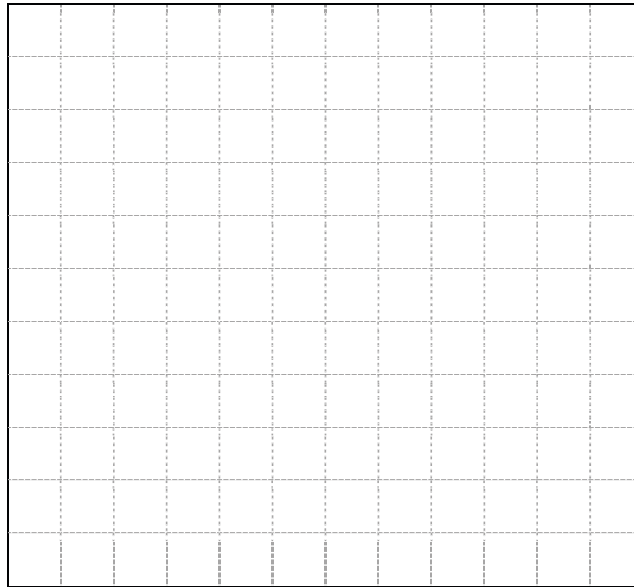


Figure 1-14. Linear and S-shape acceleration patterns.

19. Do your observations confirm that the S-shape acceleration pattern allows a motor to be started slowly?

Yes     No

Yes

20. Do your observations confirm the theory presented in the Discussion of this exercise?

Yes     No

Yes

21. Set the *Acceleration pattern selection* function to Linear by setting parameter A097 to 00.



### Torque boost

*In this section, you will observe the torque boost characteristics. You will plot the output voltage versus output frequency curve with and without torque boost.*

- 22.** Set the *Torque boost selection* function to *Manual torque boost* by setting parameter A041 to 00.

Set the *Manual torque boost voltage* function to 0% by setting parameter A042 to 0.

Set the *Manual torque boost frequency* function to 33% by setting parameter A043 to 33.

Select parameter d001 to display the output frequency.

On the DC Drive, set the potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 23.** For all voltage setpoint values shown in Table 1-13, determine the corresponding output frequency displayed on the data display of the AC Drive. Enter your results in the appropriate cells in Table 1-13.

Table 1-13. Torque boost characteristics.

Setpoint		Output voltage (V)	
Voltage (V)	f (Hz)	Without torque boost	With torque boost
1			
2			
3			
4			
5			
6			
7			
8			
9			
10			

Torque boost characteristics (120 V – 60 Hz network).

Setpoint		Output voltage (V)	
Voltage (V)	f (Hz)	Without torque boost	With torque boost
1	6	20.3	32.5
2	12	40.5	65.0
3	18	60.9	97.8
4	24	81.2	116.7
5	30	101.5	130.9
6	36	121.6	145.2
7	42	142.0	159.4
8	48	162.4	173.6
9	54	182.4	187.8
10	60	200.0	200.0

Torque boost characteristics (220 V – 50 Hz network).

Setpoint		Output voltage (V)	
Voltage (V)	f (Hz)	Without torque boost	With torque boost
1	5	38.4	61.7
2	10	77.3	124.1
3	15	115.9	186.1
4	20	154.5	221.9
5	25	193.3	249.1
6	30	231.9	276.2
7	35	270.6	303.3
8	40	309.2	330.5
9	45	347.9	357.6
10	50	380.0*	380.0*

\* The maximum voltage output of the AC Drive may be slightly below 380 V.

Torque boost characteristics (240 V – 50 Hz network).

Setpoint		Output voltage (V)	
Voltage (V)	f (Hz)	Without torque boost	With torque boost
1	5	42.0	67.4
2	10	84.2	135.5
3	15	126.5	203.2
4	20	168.8	242.3
5	25	211.0	272.0
6	30	253.2	301.5
7	35	295.4	331.2
8	40	338.0	360.9
9	45	379.9	390.5
10	50	415.0*	415.0*

\* The maximum voltage output of the AC Drive may be slightly below 415 V.

Torque boost characteristics (220 V – 60 Hz network).

Setpoint		Output voltage (V)	
Voltage (V)	f (Hz)	Without torque boost	With torque boost
1	6.0	38.4	61.7
2	12.0	77.3	124.1
3	18.0	115.9	186.1
4	24.0	154.5	221.9
5	30.0	193.3	248.9
6	36.0	231.9	276.1
7	42.0	270.8	303.3
8	48.0	309.3	330.5
9	54.0	348.1	357.4
10	60.0	380.0*	380.0*

\* The maximum voltage output of the AC Drive may be slightly below 380 V.

- 24.** Set the AC Drive to the stop mode.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the remote potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 25.** For all voltage setpoint values shown in Table 1-13, determine the corresponding output voltage displayed on the data display of the AC Drive. Enter your results in the *Without torque boost* column in Table 1-13.

- 26.** Set the AC Drive to the stop mode.

Set the *Manual torque boost voltage* function to 20% by setting parameter A042 to 20.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the remote potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 27.** For all voltage setpoint values shown in Table 1-13, determine the corresponding output voltage displayed by the data display on the AC Drive. Enter your results in the *With torque boost* column in Table 1-13.

**CAUTION**

Do not let the motor operate for a long time when the torque boost is set for low voltage setpoint values. Since the output current is higher when the torque boost is active, an overload trip could occur.

- 28.** Set the AC Drive to the stop mode.

29. Plot the curves with and without torque boost in Figure 1-15. Place the Frequency values along the X-axis, and the Output voltage values along the Y-axis.

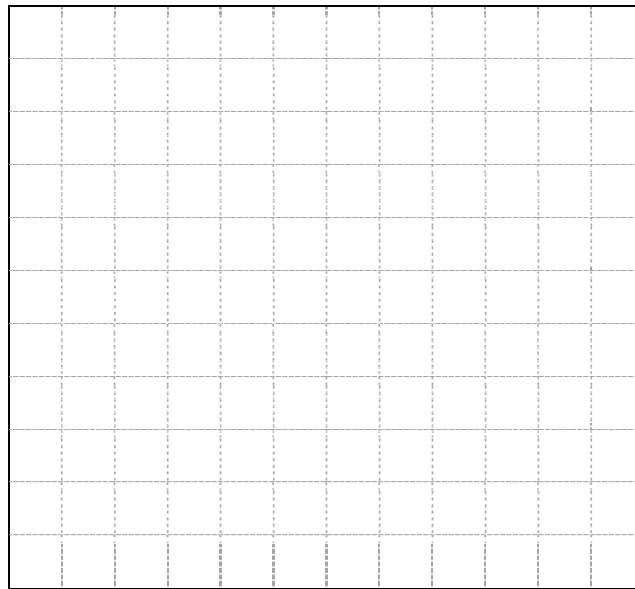


Figure 1-15. With and without torque boost characteristics.

30. At what frequency is the torque boost maximum?

Frequency where the torque boost is maximum = \_\_\_\_\_

33% of the base frequency.

31. Does the torque boost correspond to approximately 20% the output voltage at that frequency (33% of the base frequency)?

Yes     No

Yes

32. Turn off the Power Supply, disconnect the circuit, and return the equipment to the storage location.

## CONCLUSION

In this exercise, you familiarized yourself with the acceleration and deceleration time settings. You plotted the curves showing the linear and S-shape acceleration patterns.

You also experimented with the Torque boost function. You saw that it is possible to increase the voltage at a particular frequency to compensate for the voltage drop in the motor windings.

**REVIEW QUESTIONS**

1. Applications requiring slow start usually have

- a. short acceleration time.
- b. long acceleration time.
- c. short deceleration time.
- d. long deceleration time.

b

2. The purpose of an S-shape acceleration pattern is

- a. to combine soft starts and stops with high speeds when moving from a point to another.
- b. to combine rapid starts and stops with high speeds when moving from a point to another.
- c. to combine rapid starts and stops with low speeds when moving from a point to another.
- d. to combine soft starts and stops with low speeds when moving from a point to another.

a

3. Torque boost is applied at

- a. high frequencies.
- b. low frequencies.
- c. frequencies required by the load.
- d. None of the answers above is correct.

b

4. Torque boost is applied

- a. when the mass inertia moment of the connected load is high.
- b. to compensate for the voltage drop in the motor windings.
- c. beyond the normal V/f characteristic.
- d. All of the answers above are correct.

d



# Bibliography

Herman, S.L. Industrial Motor Control, Fifth Edition. Clifton Park, NY: Thomson Delmar Learning, 2005, ISBN 1401838022

Industrial Training Zone. PLC Fundamentals. Eatontown, NJ: Festo Didactic

International Electrotechnical Commission. Graphical Symbols for Diagrams. IEC 60617

National Center for Construction Education and Research. Electrical Level 3 Trainee Guide. Upper Saddle River, NJ: Pearson/Prentice Hall, 2002, ISBN 0130472239

National Electrical Manufacturers Association. Industrial Control and Systems: Diagrams, Device Designations, and Symbols. ICS 19-2002

National Electrical Manufacturers Association. NEMA and IEC Devices for Motor Services - A Guide for Understanding the Differences. ICS 2.4-2003

Rockis, G., and Glen Mazur. Electrical Motor Controls, Second Edition. Homewood, IL: American Technical Publishers Inc., 2001, ISBN 0826916759

Wildi, T. Electrical Machines, Drives and Power Systems, Sixth Edition. Englewood Cliffs, NJ: Prentice Hall, 2005, ISBN 0131776916