

Electricity and New Energy

Motor Drives

Courseware Sample

52733-F0

Order no.: 52733-10

First Edition

Revision level: 07/2016

By the staff of Festo Didactic

© Festo Didactic Ltée/Ltd, Quebec, Canada 2016

Internet: www.festo-didactic.com

e-mail: did@de.festo.com

Printed in Canada

All rights reserved

ISBN 978-2-89747-737-0 (Printed version)

ISBN 978-2-89747-739-4 (CD-ROM)

Legal Deposit – Bibliothèque et Archives nationales du Québec, 2016

Legal Deposit – Library and Archives Canada, 2016

The purchaser shall receive a single right of use which is non-exclusive, non-time-limited and limited geographically to use at the purchaser's site/location as follows.

The purchaser shall be entitled to use the work to train his/her staff at the purchaser's site/location and shall also be entitled to use parts of the copyright material as the basis for the production of his/her own training documentation for the training of his/her staff at the purchaser's site/location with acknowledgement of source and to make copies for this purpose. In the case of schools/technical colleges, training centers, and universities, the right of use shall also include use by school and college students and trainees at the purchaser's site/location for teaching purposes.

The right of use shall in all cases exclude the right to publish the copyright material or to make this available for use on intranet, Internet and LMS platforms and databases such as Moodle, which allow access by a wide variety of users, including those outside of the purchaser's site/location.

Entitlement to other rights relating to reproductions, copies, adaptations, translations, microfilming and transfer to and storage and processing in electronic systems, no matter whether in whole or in part, shall require the prior consent of Festo Didactic.

Information in this document is subject to change without notice and does not represent a commitment on the part of Festo Didactic. The Festo materials described in this document are furnished under a license agreement or a nondisclosure agreement.

Festo Didactic recognizes product names as trademarks or registered trademarks of their respective holders.

All other trademarks are the property of their respective owners. Other trademarks and trade names may be used in this document to refer to either the entity claiming the marks and names or their products. Festo Didactic disclaims any proprietary interest in trademarks and trade names other than its own.

Safety and Common Symbols

The following safety and common symbols may be used in this manual and on the equipment:

Symbol	Description
	DANGER indicates a hazard with a high level of risk which, if not avoided, will result in death or serious injury.
	WARNING indicates a hazard with a medium level of risk which, if not avoided, could result in death or serious injury.
	CAUTION indicates a hazard with a low level of risk which, if not avoided, could result in minor or moderate injury.
	CAUTION used without the <i>Caution, risk of danger</i> sign , indicates a hazard with a potentially hazardous situation which, if not avoided, may result in property damage.
	Caution, risk of electric shock
	Caution, hot surface
	Caution, risk of danger
	Caution, lifting hazard
	Caution, hand entanglement hazard
	Notice, non-ionizing radiation
	Direct current
	Alternating current
	Both direct and alternating current
	Three-phase alternating current
	Earth (ground) terminal

Safety and Common Symbols

Symbol	Description
	Protective conductor terminal
	Frame or chassis terminal
	Equipotentiality
	On (supply)
○	Off (supply)
	Equipment protected throughout by double insulation or reinforced insulation
	In position of a bi-stable push control
	Out position of a bi-stable push control

Table of Contents

Preface	IX
About This Manual	XI
To the Instructor	XIII
Unit 1 AC Drives.....	1
DISCUSSION OF FUNDAMENTALS.....	1
Motor speed	2
Ex. 1-1 AC Drive Overview	3
DISCUSSION	3
Keypad	4
Input and output terminals	5
Microswitches.....	5
Parameters.....	6
Setting the value of a parameter.....	8
Reading the current setting of a parameter	8
Quick parameter selection	8
Initialization procedure	9
PROCEDURE	10
Set up and connections	10
Parameters.....	11
Initialization procedure	12
Basic motor control functions	12
Quick parameter selection	14
Ex. 1-2 Volts per Hertz Characteristics	17
DISCUSSION	17
Direction of rotation	17
V/f characteristic.....	17
Frequency reference selection.....	18
PROCEDURE	19
Set up and connections	19
Direction of rotation	19
V/f characteristic.....	21
Ex. 1-3 Ramp and Torque Boost.....	27
DISCUSSION	27
Acceleration and deceleration times	27
Acceleration and deceleration patterns.....	28
Torque boost.....	29

Table of Contents

PROCEDURE	30
Set up and connections.....	30
Acceleration and deceleration ramps.....	30
Acceleration characteristic	32
Torque boost.....	36
Ex. 1-4 Protection	43
DISCUSSION	43
Limiting motor current	43
Overload alarm signal	44
Overtoltage during deceleration	45
Multi-function output.....	45
PROCEDURE	47
Set up and connections.....	47
Limiting motor current	47
Overload alarm signal	52
Overtoltage during deceleration	54
Ex. 1-5 Braking and Jogging	57
DISCUSSION	57
Mechanical friction brake	57
DC braking	58
Jog mode	58
Multi-function inputs	59
PROCEDURE	60
Set up and connections.....	60
Mechanical friction brake	61
DC braking	62
Jog mode	65
Ex. 1-6 Remote Controls.....	69
DISCUSSION	69
Introduction	69

Table of Contents

PROCEDURE	69
Set up and connections	69
Project description.....	70
Tips.....	70
Equipment selection.....	71
Schematic diagram of the circuit.....	73
Circuit setup	74
AC Drive parameter values.....	75
Circuit approval	75
Additional experiment.....	76
Tips.....	76
Important.....	81
Unit 2 DC Drives.....	87
DISCUSSION	87
Introduction	87
Ex. 2-1 DC Drive Overview	89
DISCUSSION	89
Input and output terminals	90
Parameters.....	90
Minimum speed.....	91
Maximum speed.....	91
PROCEDURE	91
Set up and connections	91
Minimum speed.....	93
Maximum speed.....	93
Speed versus voltage characteristic	93
Additional speed settings	96
Direction of rotation	97
Ex. 2-2 Current Limiting and IR Compensation	99
DISCUSSION	99
Current limiting	99
IR compensation	99
PROCEDURE	100
Set up and connections	100
Current limiting	101
IR compensation	101
Appendix A Equipment Utilization Chart	107
Appendix B Diagram Symbols	109

Table of Contents

Appendix C Basic Setup and Lockout/Tagout Procedures.....	113
Basic Setup procedure.....	113
Lockout/Tagout procedure (de-energizing procedure)	115
Energizing procedure	116
Module identification	117
Appendix D Coupling Motors	119
Appendix E Alignment	121
Flexible couplings.....	121
Alignment	121
Alignment methods	122
Appendix F AC Drive – Error Codes and Parameter Numbers.....	125
Appendix G DC Motor Characteristics	163
Bibliography	165

Preface

The Motor Drives Training System, model 8036-3, introduces the use of the AC and DC drives to control electric motors.

The Motor Drives Training System is part of the Industrial Controls Training Program, which includes the following systems:

- Basic Controls, model 8036-1;
- Programmable Logic controller, model 8036-2;
- Motor Drives, model 8036-3;
- Sensors, model 8036-4;
- Troubleshooting, 8036-5.

We hope that your learning experience will be the first step of a successful career.

We invite readers of this manual to send us their tips, feedback, and suggestions for improving the book.

Please send these to did@de.festo.com.

The authors and Festo Didactic look forward to your comments.

About This Manual

Manual objectives

The exercises in this manual, Motor Drives complement the exercises contained in the manual Basic Controls. They provide the knowledge necessary to perform motor controls with the help of motor drives.

The present manual is divided into two units:

- Unit 1 introduces the AC Drive and its main functions;
- Unit 2 introduces the DC Drive and its main functions.

Each unit contains exercises which provide a systematic and realistic means of learning the subject matter. Each exercise is divided into the following sections:

- A clearly defined Exercise Objective;
- A Discussion of the theory involved in the exercise;
- A Procedure Summary which provides a bridge between the theoretical Discussion and the laboratory Procedure;
- A step-by-step laboratory Procedure in which the students observe and quantify important principles covered in the Discussion;
- A Conclusion to summarize the material presented in the exercise;
- Review Questions to verify that the material has been well assimilated.

A ten-question test at the end of each unit allows the student's knowledge of the unit material to be assessed.

Safety considerations

Safety symbols that may be used in this manual and on the equipment are listed in the Safety Symbols table at the beginning of the manual.

Safety procedures related to the tasks that you will be asked to perform are indicated in each exercise.

Make sure that you are wearing appropriate protective equipment when performing the tasks. You should never perform a task if you have any reason to think that a manipulation could be dangerous for you or your teammates.

Reference material

Refer to the user manuals of the drives for detailed information on how to use the devices. These manuals are included on the CD supplied with the training system.

Prerequisite

To perform the exercises in this manual, you should have completed the manual Basic Controls, part number 39163.

About This Manual

Before performing an exercise, you should have read the pages of the AC Drive or DC Drive user manuals that deal with the covered topics. Ask your instructor for a copy, or download the file from the manufacturer's website.

Systems of units

Units are expressed using the International System of Units (SI) followed by units expressed in the U.S. customary system of units (between parentheses).

To the Instructor

You will find in this Instructor Guide all the elements included in the Student Manual together with the answers to all questions, results of measurements, graphs, explanations, suggestions, and, in some cases, instructions to help you guide the students through their learning process. All the information that applies to you is placed between markers and appears in red.

Accuracy of measurements

The numerical results of the hands-on exercises may differ from one student to another. For this reason, the results and answers given in this manual should be considered as a guide. Students who correctly performed the exercises should expect to demonstrate the principles involved and make observations and measurements similar to those given as answers.

Notes to the instructor

- Before a student begins an exercise, ensure that the equipment is in good condition and does not represent any risk when used.
- This guide provides you with the answers to questions.
- Make sure that the students understand the objectives of the work to do.
- The default setting of some parameters depends on the Country parameter of the AC Drive. For this reason, the default setting values shown in the user guide may differ from the current default settings of the AC Drive.
- If the AC Drive OMRON is displaying error E12 even if nothing is connected to the Multi-function inputs, one of the Multi-function inputs is configured for a low-level signal (like the normally closed contact of the Emergency Button). To clear error E12, you must apply 24 V dc on this input and press the STOP/RESET button. If you do not know which input is configured that way, apply 24 V dc (from terminal P24) to input S1 and try to clear the error. If it does not work, try again with input S2, S3, S4, S5, S6 and S7. Once the error is cleared, initialize the AC Drive by performing the Initialization procedure shown in the student manual.

Sample Exercise
Extracted from
Student Manual

Ramp and Torque Boost

EXERCISE OBJECTIVE

The exercise objectives are listed below:

- Understand the acceleration and deceleration time settings.
- Introduce the linear and S-shape acceleration and deceleration patterns.
- Introduce the Torque boost function.

DISCUSSION OUTLINE

The Discussion of this exercise covers the following points:

- Acceleration and deceleration times
- Acceleration and deceleration patterns
- Torque boost

DISCUSSION

Acceleration and deceleration times

The acceleration time defines the time duration in which the AC Drive reaches its maximum frequency after a start signal is issued. Short acceleration times are usually for light loads, and long acceleration times for heavy loads, or in applications requiring soft start such as a bottle conveyor. The Acceleration time function is also known as ramping. See Figure 1-10.

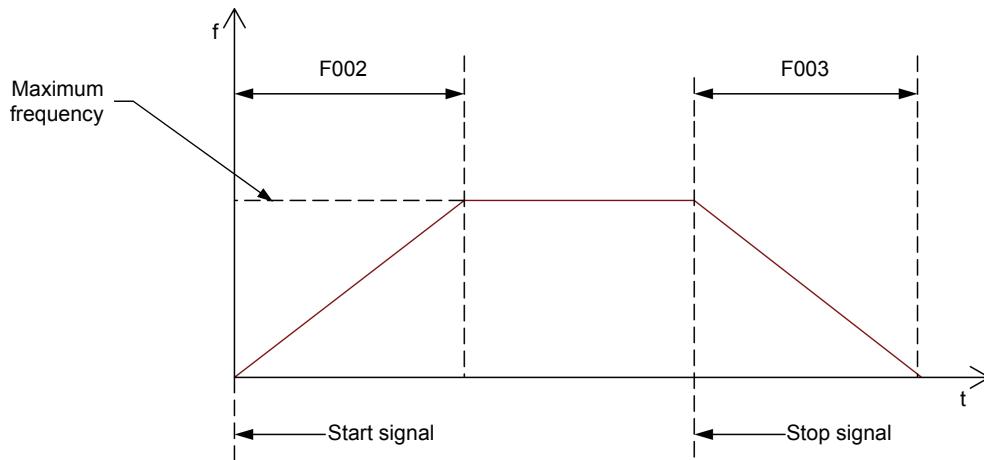


Figure 1-10. Acceleration/deceleration ramps.

Conversely, the deceleration time defines the time duration in which the AC Drive reduces the output frequency from the maximum frequency to 0 Hz after a stop signal. If the equipment connected to a motor has low friction and a lot of inertia, it could coast for a long time. The Deceleration time function allows the load to be stopped more quickly.

The *Acceleration time setting* and *Deceleration time setting* functions are set using parameters F002 and F003. The characteristics of these parameters are shown in Table 1-10.

Table 1-10. Characteristics of parameters F002, F003, A097, A098, and b082.

Parameter	Function	Value	DS
F002	<i>Acceleration time setting</i>	0.01 to 3600 s	10.00
F003	<i>Deceleration time setting</i>	0.01 to 3600 s	10.00
A097	<i>Acceleration pattern selection</i>	00: Linear 01: S-shape curve 02: U shape 03: Reverse-U shape 04: EL-S shape	01
A098	<i>Deceleration pattern selection</i>	00: Linear 01: S-shape curve 02: U shape 03: Reverse-U shape 04: EL-S shape	01
b082*	<i>Starting frequency</i>	0.01 to 9.99	1.5

* Parameter b082 directly affects real acceleration/deceleration times. In order to actually obtain the time values set to F002 and F003, the starting frequency must be set to its lowest value.

Acceleration and deceleration patterns

The acceleration and deceleration patterns can be linear or S shape. When a motor is started or stopped using the linear acceleration or deceleration patterns, its rate of change until it reaches full speed, or comes to a complete stop, is linear. See Figure 1-11.

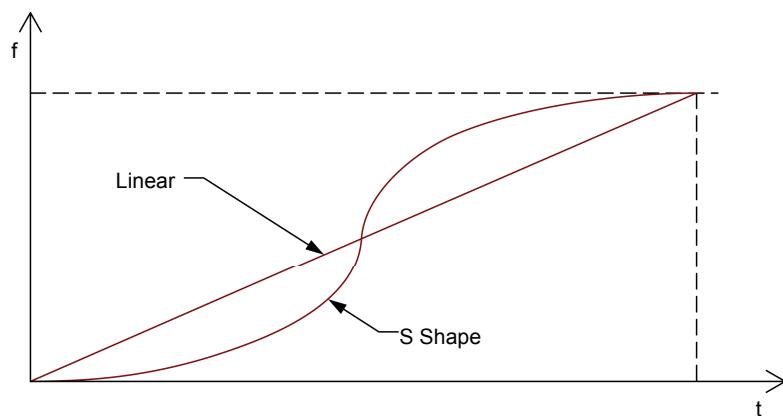


Figure 1-11. Linear and S-shape patterns during acceleration.

When the motor is started or stopped, using the S-shape acceleration or deceleration pattern, its rate of change gradually increases or decreases until it reaches full speed, or comes to a complete stop. The purpose of the S-shape pattern is to combine soft starts and soft stops with high speeds between them.

The movement of an elevator is an example of the S-shape acceleration/deceleration pattern.

The *Acceleration pattern selection* and *Deceleration pattern selection* functions are set using parameters A097 and A098. The characteristics of these parameters are shown in Table 1-10.

Torque boost

If the mass inertia moment or static friction of the connected load is high, it may be necessary to increase (boost) the output voltage beyond the normal V/f characteristics at low output frequencies. This compensates for the voltage drop in the motor windings and can be up to half of the motor's nominal voltage.

The torque boost (voltage increase) is defined as a percentage value. As Figure 1-12 shows, the Manual torque boost voltage function (parameter A042) is a percentage of the output voltage and the Manual torque boost frequency function (A043) is a percentage of the frequency.

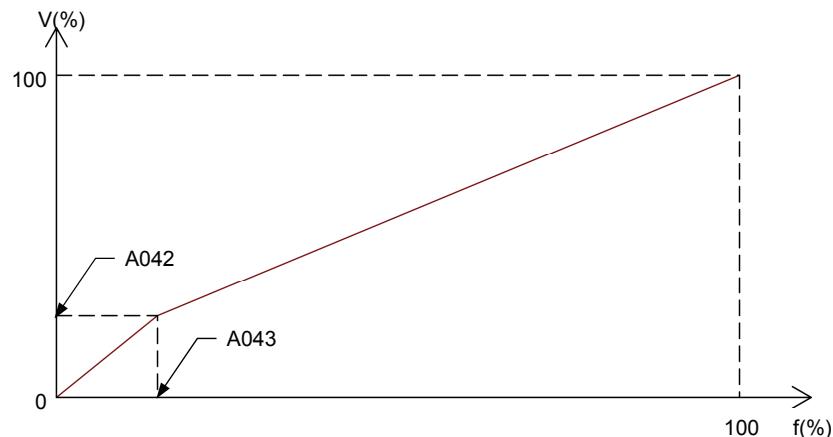


Figure 1-12. Torque boost.

The Torque boost selection function (parameter A041) lets you select between manual and automatic torque boost. Automatic torque boost is added to the V/f characteristics depending on the current load.

The torque boost functions are set using parameters A041, A042 and A043. The characteristics of these parameters are shown in Table 1-11.

Table 1-11. Characteristics of parameters A041, A042, and A043.

Parameter	Function	Value	DS
A041	<i>Torque boost selection</i>	00: Manual 01: Automatic	01
A042	<i>Manual torque boost voltage</i>	0 to 20 % of output voltage	1.0
A043	<i>Manual torque boost frequency</i>	0 to 50 % of base frequency	5.0

PROCEDURE OUTLINE

The Procedure is divided into the following sections:

- Set up and connections
- Acceleration and deceleration ramps
- Acceleration characteristic
- Torque boost

PROCEDURE

Set up and connections

In this section, you will setup the AC Drive.

WARNING



The AC Power Supply provides high voltages. Do not change any AC connection with the power on.

1. Perform the Basic Setup and Lockout/Tagout procedures.

Acceleration and deceleration ramps

In this section, you will familiarize yourself with the setting of the acceleration and deceleration times.

2. Install the Brake Motor, Inertia Wheel, and Safety Guard.
3. Setup the circuit shown in Figure 1-8

4. Manually disengage the friction brake.

Connect a voltmeter between terminals FV and SC on the AC Drive.

Perform the Energizing procedure.

5. Set the parameters of the AC Drive as follows:
 - Restore the default setting of the parameters and configure the AC Drive according to the ratings of the Brake Motor by performing the Initialization procedure;
 - Select *Control circuit terminal block* as *Frequency reference selection* function by setting parameter A001 to 01;
 - Set the *Starting frequency* to 0.01 Hz by setting parameter b082 to 0.01;
 - Set the AC Drive to display the output voltage by selecting parameter d013.

6. On the DC Drive, set the remote potentiometer to obtain 10.0 V dc on the voltmeter display.

Determine the acceleration time by starting a chronometer as you set the AC Drive to the run mode, and stopping it when the data display indicates the maximum output voltage for your network (200 V or 380 V depending on your local network). Repeat the measurement to validate your results.

Acceleration time = _____

7. Does this correspond to the default setting of the *Acceleration time setting* function (parameter F002)?

Yes No

8. Set the AC Drive to the run mode and wait for the motor to attain maximum speed.

Determine the deceleration time by starting a chronometer as you set the AC Drive to the stop mode, and stopping it when the data display indicates 0 V. Repeat the measurement to validate your result.

Deceleration time = _____

9. Does this correspond to the default setting of the *Deceleration time setting* (F003)?

Yes No

10. Familiarize yourself with the setting of acceleration and deceleration times by setting a 20.00 s acceleration time and a 15.00 s deceleration time.

Test the operation of your circuit.

11. Turn off the Lockout module.

Acceleration characteristic

In this section, you will plot the linear and S-shape acceleration patterns.

12. Remove the Safety Guard, and Inertia Wheel.

Couple the DC Motor with the Brake Motor as described in Appendix D.

- 13.** Connect the Starting Resistors module to the DC Motor as shown in Figure 1-13.

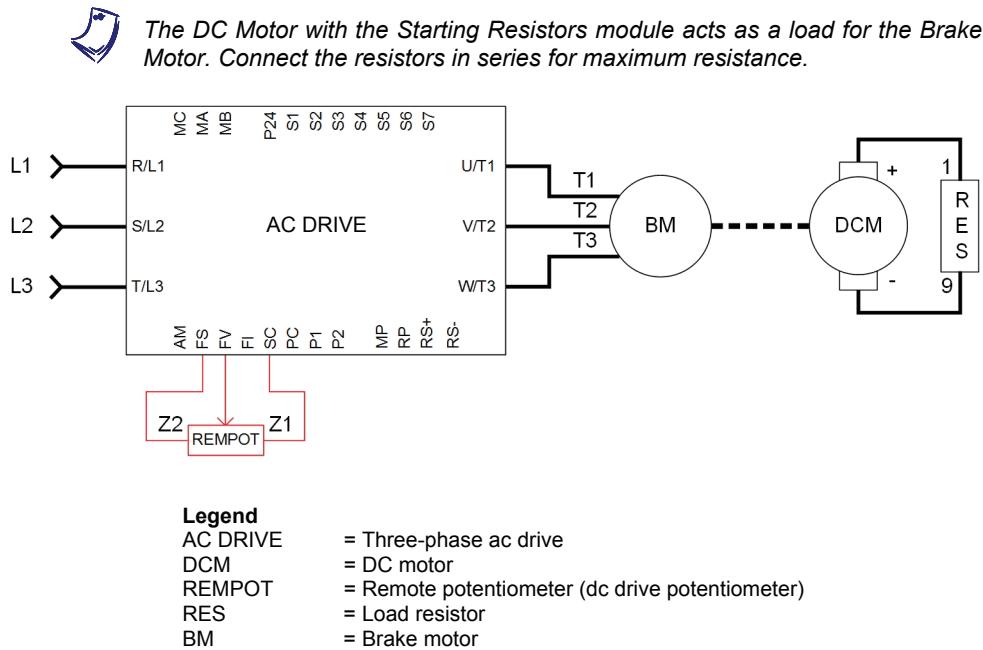


Figure 1-13. Connect the Starting Resistors module to the DC Motor.

- 14.** Turn on the Lockout module.

Set the remote potentiometer to obtain 10.0 V dc on the voltmeter display.

Set the *Acceleration time setting* to 30 s by setting parameter F002 to 30.00.

Set the *Acceleration pattern selection* function to Linear by setting parameter A097 to 00.

Select parameter d001 to display the output frequency.

- 15.** Measure the time taken by the AC Drive to attain 10 Hz by starting the chronometer as you set the AC Drive to the run mode, and stopping it when the AC Drive indicates 10 Hz. Repeat the measurements to validate your results.

Enter your result in the appropriate cell in the Linear column in Table 1-12.

Set the AC Drive to the stop mode.

Table 1-12. Linear and S-shape acceleration patterns.

Frequency range	Time (s)	
	Acceleration pattern	
	Linear	S-shape
0 to 10 Hz		
0 to 20 Hz		
0 to 30 Hz		
0 to 40 Hz		
0 to 50 Hz		
0 to 60 Hz (if applicable)		

- 16.** Repeat the previous measurement for all frequency ranges shown in Table 1-12.

Enter your results in the appropriate cells in the Linear column in Table 1-12.

- 17.** Set the AC Drive to the stop mode.

Set the *Acceleration pattern selection* function (A097) to 01 to select the S-shape acceleration pattern.

Select parameter d001 to display the output frequency.

- 18.** Repeat the measurements to fill out the empty cells of Table 1-12 with the S-shape acceleration pattern.

- 19.** Set the AC Drive to the stop mode.

- 20.** Plot the curves showing the linear and S-shape acceleration patterns in Figure 1-14. Place the Time values along the X-axis, and the Frequency values along the Y-axis.



Figure 1-14. Linear and S-shape acceleration patterns.

- 21.** Do your observations confirm that the S-shape acceleration pattern allows a motor to be started slowly?

Yes No

- 22.** Do your observations confirm the theory presented in the Discussion of this exercise?

Yes No

- 23.** Set the *Acceleration pattern selection* function to *Linear* by setting parameter A097 to 00.

Torque boost

In this section, you will observe the torque boost characteristics. You will plot the output voltage versus output frequency curve with and without torque boost.

- 24.** Set the *Torque boost selection* function to *Manual torque boost* by setting parameter A041 to 00.

Set the *Manual torque boost voltage* function to 0% by setting parameter A042 to 0.

Set the *Manual torque boost frequency* function to 33% by setting parameter A043 to 33.

Select parameter d001 to display the output frequency.

On the DC Drive, set the potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 25.** For all voltage setpoint values shown in Table 1-13, determine the corresponding output frequency displayed on the data display of the AC Drive. Enter your results in the appropriate cells in Table 1-13.

Table 1-13. Torque boost characteristics.

Setpoint		Output voltage (V)	
Voltage (V)	f (Hz)	Without torque boost	With torque boost
1			
2			
3			
4			
5			
6			
7			
8			
9			
10			

- 26.** Set the AC Drive to the stop mode.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the remote potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 27.** For all voltage setpoint values shown in Table 1-13, determine the corresponding output voltage displayed on the data display of the AC Drive. Enter your results in the *Without torque boost* column in Table 1-13.

28. Set the AC Drive to the stop mode.

Set the *Manual torque boost voltage* function to 20% by setting parameter A042 to 20.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the remote potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

29. For all voltage setpoint values shown in Table 1-13, determine the corresponding output voltage displayed by the data display on the AC Drive. Enter your results in the *With torque boost* column in Table 1-13.

CAUTION

Do not let the motor operate for a long time when the torque boost is set for low voltage setpoint values. Since the output current is higher when the torque boost is active, an overload trip could occur.

30. Set the AC Drive to the stop mode.

31. Plot the curves with and without torque boost in Figure 1-15. Place the Frequency values along the X-axis, and the Output voltage values along the Y-axis.

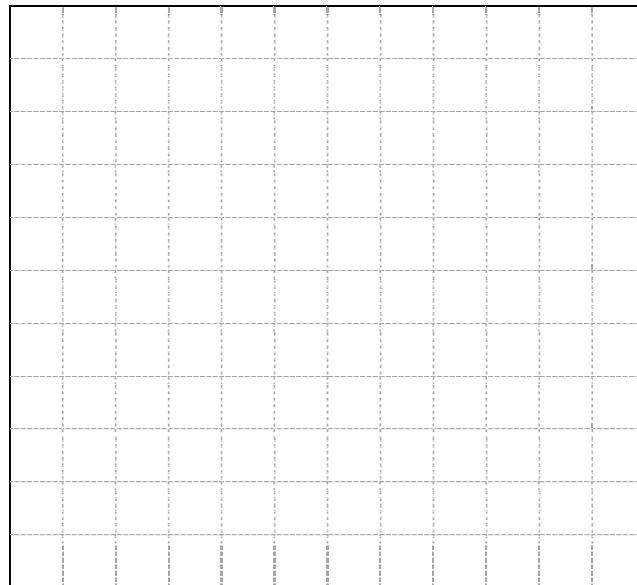


Figure 1-15. With and without torque boost characteristics.

32. At what frequency is the torque boost maximum?

Frequency where the torque boost is maximum = _____

33. Does the torque boost correspond to approximately 20% the output voltage at that frequency (33% of the base frequency)?

Yes No

34. Turn off the individual power switch of the AC Power Supply off, disconnect the circuit, and return the equipment to the storage location.

CONCLUSION

In this exercise, you familiarized yourself with the acceleration and deceleration time settings. You plotted the curves showing the linear and S-shape acceleration patterns.

You also experimented with the Torque boost function. You saw that it is possible to increase the voltage at a particular frequency to compensate for the voltage drop in the motor windings.

REVIEW QUESTIONS

1. Applications requiring slow start usually have

- a. short acceleration time.
- b. long acceleration time.
- c. short deceleration time.
- d. long deceleration time.

2. The purpose of an S-shape acceleration pattern is

- a. to combine soft starts and stops with high speeds when moving from a point to another.
- b. to combine rapid starts and stops with high speeds when moving from a point to another.
- c. to combine rapid starts and stops with low speeds when moving from a point to another.
- d. to combine soft starts and stops with low speeds when moving from a point to another.

3. Torque boost is applied at

- a. high frequencies.
- b. low frequencies.
- c. frequencies required by the load.
- d. None of the answers above is correct.

4. Torque boost is applied

- a. when the mass inertia moment of the connected load is high.
- b. to compensate for the voltage drop in the motor windings.
- c. beyond the normal V/f characteristic.
- d. All of the answers above are correct.

Sample
Extracted from
Instructor Guide

Volts per Hertz Characteristics

EXERCISE OBJECTIVE

The exercise objectives are listed below:

- Set the rotation direction of the motor.
- Understand the V/f (volts per hertz) characteristics.
- Learn how to use an analog voltage to assign the frequency setpoint.

DISCUSSION OUTLINE

The Discussion of this exercise covers the following points:

- Direction of rotation
- V/f characteristic
- Frequency reference selection

DISCUSSION

Direction of rotation

The *RUN direction selection* function defines the direction in which the motor turns after a start signal is issued.

The *RUN direction selection* function is set using parameter F004. The characteristics of this parameter are shown in Table 1-6.

Table 1-6. Characteristics of parameters F004, A003, and A004.

Parameter	Function	Value	DS
F004	<i>RUN direction selection</i>	00: Forward 01: Reverse	00
A004	<i>Maximum Frequency</i>	30 to 400	60
A003	<i>Base Frequency</i>	30 to Max. frequency [A004]	60
DS: default setting			
Set parameters A003 and A004 to 50 if the frequency of your local network is 50 Hz.			

V/f characteristic

The V/f (volts per hertz) characteristic is the ratio of output voltage to output frequency, which determines the motor's ability to develop torque. As seen previously, an increase in frequency causes a corresponding increase in speed. However, increasing the frequency without increasing the voltage reduces the motor's ability to develop torque.

The AC Drive of your training system offers four V/f characteristics: constant torque, reduced torque, free v/f setting, and sensorless vector control. See Figure 1-7.

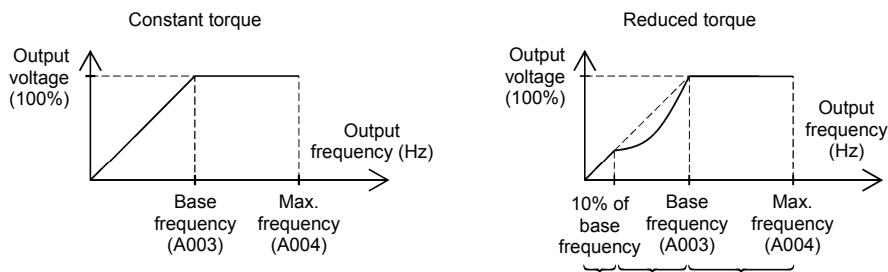


Figure 1-7. V/f characteristics.

With the *Constant torque characteristics*, the output voltage is proportional to the output frequency. While proportional from 0 Hz to base frequency, the output voltage is constant from base to maximum frequencies regardless of the frequency.

The *Reduced torque characteristics* are suitable for a fan or pump that requires torque in a low speed range. They provide constant torque characteristics within a range from 0 Hz to 10% of the base frequency. Then, they provide reduced torque characteristics within a range from 10% to 100% of the base frequency. For frequencies higher than the base frequency, they provide constant voltage within a range from the base frequency to the maximum frequency.

The *Control method* function is set using parameter A044. The characteristics of this parameter are shown in Table 1-7.

Table 1-7. Characteristics of parameter A044.

Parameter	Function	Value	DS
A044	<i>Control method</i>	00: Constant torque 01: Reduced torque 02: Free V/f setting 03: Sensorless vector control	00

Frequency reference selection

In Exercise 1-1, you used the *Output frequency setting* parameter to vary the frequency reference (setpoint). There are other ways to assign the frequency reference:

- through terminal analog input voltage and analog input current;
- using a pulse train frequency input with the RP terminal;
- using ModBus communication;
- using frequency operation result.

The *Frequency reference selection* function is set using parameter A001. The characteristics of this parameter are shown in Table 1-8.

Table 1-8. Characteristics of parameter A001.

Parameter	Function	Value	DS
A001	Frequency reference selection	00: Digital operator (volume) 01: Control circuit terminal block 02: Digital operator (F001) 03: ModBus communication 06: Pulse train frequency 10: Operation function output	02

PROCEDURE OUTLINE

The Procedure is divided into the following sections:

- Set up and connections
- Direction of rotation
- V/f characteristic

PROCEDURE**Set up and connections**

In this section, you will setup the AC Drive.


WARNING


The AC Power Supply provides high voltages. Do not change any AC connection with the power on.

1. Perform the Basic Setup and Lockout/Tagout procedures.


Direction of rotation

In this section, you will use a remote potentiometer for controlling the rotation speed of the Brake Motor, and you will change the rotation direction by changing the setting of the RUN direction selection function.

2. Install the Brake Motor, Inertia Wheel, and Safety Guard.
3. Set up the circuit shown in Figure 1-8



In this circuit, the potentiometer of the DC Drive is used as remote potentiometer. You will apply the Frequency reference power supply (+10 V dc) supplied via terminal FS on the AC Drive to the remote potentiometer and you will apply the wiper voltage from the remote potentiometer (↑) to the Frequency reference input voltage (terminal FV) as shown in the following figure.

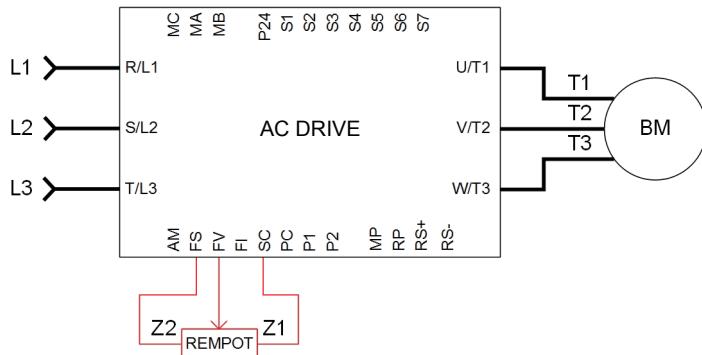

Legend

- AC DRIVE = Three-phase ac drive
- REMPOT = Remote potentiometer (dc drive potentiometer)
- BM = Brake motor

Figure 1-8. Circuit using a remote potentiometer.

4. Manually disengage the friction brake.

Connect a voltmeter between terminals FV and SC on the AC Drive.

On the DC Drive, set the remote potentiometer to 0.

Perform the Energizing procedure.

5. Set the parameters of the AC Drive as follows:

- Restore the default setting of the parameters and configure the AC Drive according to the ratings of the Brake Motor by performing the Initialization procedure;
- Select *Control circuit terminal block as Frequency reference selection* function by setting parameter A001 to 01;
- Select parameter d001 to display the output frequency.

6. Referring to the default setting of the *RUN direction selection* function, parameter F004, in which direction will the motor rotate?

- Forward
- Reverse

Forward

7. Press the RUN key to set the AC Drive to the run mode.

8. On the DC Drive, set the remote potentiometer to obtain 1.0 V dc on the voltmeter display.

9. Does the direction of rotation correspond to the default setting of the *RUN direction selection* parameter?

Yes No

Yes

10. Enter the frequency displayed by the AC Drive in Table 1-9.

Repeat the voltage setting for all the values shown in the Voltage column of Table 1-9. For each setting, enter the corresponding frequency displayed by the AC Drive.

11. Press the STOP/RESET key to set the AC Drive to the stop mode.

12. Set the *RUN direction selection* to reverse by setting parameter F004 to 01.

On the DC Drive, set the remote potentiometer to obtain 1.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

Does the motor rotate in the reverse direction?

Yes No

Yes

13. Set the AC Drive to the stop mode.

V/f characteristic

In this section, you will plot the curves showing the constant torque and reduced torque V/f characteristics.

14. What is the default setting of the *Control method* function?

- Constant torque
- Reduced torque
- Free V/f setting
- Sensorless vector control

Constant torque

- 15.** Set the *RUN direction selection* function to forward by setting parameter F004 to 00.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the AC Drive to the run mode.

- 16.** On the DC Drive, set the potentiometer to obtain 1.0 V dc on the voltmeter display.

Enter the output voltage value displayed by the AC Drive display in the CONSTANT TORQUE column, and the speed of rotation, in the n column of Table 1-9. Fill out the table for all other setpoint values.



If a tachometer is not available, determine the speed from the equation shown in the DISCUSSION OF FUNDAMENTALS.

Table 1-9. V/f characteristics.

V/f characteristics				
Setpoint		n (rpm)	Output voltage (V)	
Voltage (V)	f (Hz)		Constant torque	Reduced torque
1				
2				
3				
4				
5				
6				
7				
8				
9				
10 ⁽¹⁾				

(1) The AVR function of the Inverter outputs voltage to the motor correctly even if the incoming voltage to the Inverter fluctuates. With this function, output voltage to the motor is limited to 200 V, 380 V, or 415 V depending on your local ac power network.

V/f characteristics (120 V - 60 Hz network).

V/f characteristics				
Setpoint		n (rpm)	Output voltage (V)	
Voltage (V)	f (Hz)		Constant torque	Reduced torque
1	6	172.3	26.9	26.9
2	12	352.3	45.2	33.3
3	18	532.6	64.5	44.6
4	24	713.1	84.0	59.1
5	30	892.9	103.5	76.5
6	36	1073	123.2	96.7
7	42	1253	142.9	119.4
8	48	1433	162.6	144.5
9	54	1612	182.2	172.2
10	60	1794	200.0	200.0

V/f characteristics (220/240 V - 50 Hz network).

V/f characteristics				
Setpoint		n (rpm)	Output voltage (V)	
Voltage (V)	f (Hz)		Constant torque	Reduced torque
1	5	143.5	56.7	56.7
2	10	291.3	89.5	67.0
3	15	440.1	125.1	87.1
4	20	590.9	162.0	114.1
5	25	741.8	199.3	147.0
6	30	890.6	236.0	185.3
7	35	1041	273.1	228.1
8	40	1192	310.5	275.9
9	45	1342	347.3	328.1
10	50	1492	380.0*	380.0*

* The maximum voltage output by the AC Drive may be slightly below 380 V.

V/f characteristics (220 V - 60 Hz network).

V/f characteristics				
Setpoint		n (rpm)	Output voltage (V)	
Voltage (V)	f (Hz)		Constant torque	Reduced torque
1	6	169.7	55.4	55.4
2	12	349.6	88.7	67.2
3	18	528.1	124.7	88.0
4	24	709.5	161.7	115.1
5	30	890.1	199.1	147.9
6	36	1068	236.1	185.9
7	42	1249	273.3	229.0
8	48	1429	310.7	276.7
9	54	1608	347.7	328.7
10	60	1791	380.0*	380.0*

* The maximum voltage output by the AC Drive may be slightly below 380 V.

17. Set the AC Drive to the stop mode.

18. Select the *Reduced torque characteristics* by setting parameter A044 to 01.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the AC Drive to the run mode, and repeat the measurements for all setpoint values shown in Table 1-9. Enter the output voltage values displayed by the AC Drive display in the REDUCED TORQUE column.

19. Set the AC Drive to the stop mode.

- 20.** Plot the curves showing the constant torque and reduced torque V/f characteristics in Figure 1-9.

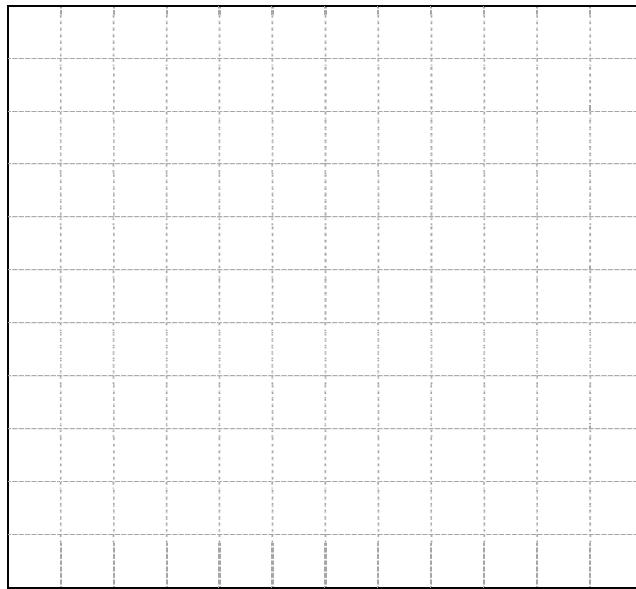


Figure 1-9. Constant torque and reduced torque V/f characteristics.

- 21.** Are the curves plotted with the constant torque and reduced torque V/f characteristics similar to those shown in the Discussion of this exercise?

Yes No

Yes

- 22.** Turn the individual power switch of the AC Power Supply off, disconnect the circuit, and return the equipment to the storage location.

CONCLUSION

In this exercise, you changed the rotation direction by changing the value of the *RUN direction selection* function parameter. You learned how to apply the setpoint using a remote potentiometer connected to an analog input of the AC Drive.

You plotted the constant torque and reduced torque V/f characteristics of the AC Drive, and saw that the reduced torque V/f characteristics give a reduced torque for frequencies between 10% and 100% of the base frequency.

REVIEW QUESTIONS

1. The V/f characteristics of the AC Drive of your training system are
 - a. constant torque, reduced torque, free V/f setting and sensorless vector control.
 - b. constant torque and torque boost.
 - c. reduced torque and torque boost.
 - d. free V/f setting and torque boost.

 **c**

2. The V/f characteristic is
 - a. the ratio of output frequency to output voltage.
 - b. the ratio of output voltage to output frequency.
 - c. the ratio of output current to output voltage.
 - d. None of the answers above is correct.

 **b**

3. Increasing the frequency without increasing the voltage
 - a. increases the motor's ability to develop torque.
 - b. reduces the motor's ability to develop torque.
 - c. does not affect the motor's ability to develop torque.
 - d. None of the answers above is correct.

 **b**

4. On the AC Drive, what is the terminal SC used for?
 - a. Input signal common
 - b. Input signal power supply output
 - c. Input signal input (voltage directive)
 - d. Input signal input (current directive)

 **a**

5. Parameter A001 function determines the
 - a. frequency reference output.
 - b. country parameter.
 - c. frequency reference input.
 - d. V/f characteristic.

 **c**

Bibliography

Herman, S.L. Industrial Motor Control, Fifth Edition. Clifton Park, NY: Thomson Delmar Learning, 2005, ISBN 1401838022

Industrial Training Zone. PLC Fundamentals. Eatontown, NJ: Festo Didactic

International Electrotechnical Commission. Graphical Symbols for Diagrams. IEC 60617

National Center for Construction Education and Research. Electrical Level 3 Trainee Guide. Upper Saddle River, NJ: Pearson/Prentice Hall, 2002, ISBN 0130472239

National Electrical Manufacturers Association. Industrial Control and Systems: Diagrams, Device Designations, and Symbols. ICS 19-2002

National Electrical Manufacturers Association. NEMA and IEC Devices for Motor Services - A Guide for Understanding the Differences. ICS 2.4-2003

Rockis, G., and Glen Mazur. Electrical Motor Controls, Second Edition. Homewood, IL: American Technical Publishers Inc., 2001, ISBN 0826916759

Wildi, T. Electrical Machines, Drives and Power Systems, Sixth Edition. Englewood Cliffs, NJ: Prentice Hall, 2005, ISBN 0131776916