

Industrial Maintenance

Motor Drives

Courseware Sample

87668-F0

Order no.: 87668-10
First Edition
Revision level: 09/2016

By the staff of Festo Didactic

© Festo Didactic Ltée/Ltd, Quebec, Canada 2011
Internet: www.festo-didactic.com
e-mail: did@de.festo.com

Printed in Canada
All rights reserved
ISBN 978-2-89640-468-1 (Printed version)
ISBN 978-2-89640-708-8 (CD-ROM)
Legal Deposit – Bibliothèque et Archives nationales du Québec, 2011
Legal Deposit – Library and Archives Canada, 2011

The purchaser shall receive a single right of use which is non-exclusive, non-time-limited and limited geographically to use at the purchaser's site/location as follows.

The purchaser shall be entitled to use the work to train his/her staff at the purchaser's site/location and shall also be entitled to use parts of the copyright material as the basis for the production of his/her own training documentation for the training of his/her staff at the purchaser's site/location with acknowledgement of source and to make copies for this purpose. In the case of schools/technical colleges, training centers, and universities, the right of use shall also include use by school and college students and trainees at the purchaser's site/location for teaching purposes.

The right of use shall in all cases exclude the right to publish the copyright material or to make this available for use on intranet, Internet and LMS platforms and databases such as Moodle, which allow access by a wide variety of users, including those outside of the purchaser's site/location.

Entitlement to other rights relating to reproductions, copies, adaptations, translations, microfilming and transfer to and storage and processing in electronic systems, no matter whether in whole or in part, shall require the prior consent of Festo Didactic.












 



 
Information in this document is subject to change without notice and does not represent a commitment on the part of Festo Didactic. The Festo materials described in this document are furnished under a license agreement or a nondisclosure agreement.

Festo Didactic recognizes product names as trademarks or registered trademarks of their respective holders.

All other trademarks are the property of their respective owners. Other trademarks and trade names may be used in this document to refer to either the entity claiming the marks and names or their products. Festo Didactic disclaims any proprietary interest in trademarks and trade names other than its own.

Safety and Common Symbols

The following safety and common symbols may be used in this manual and on the equipment:

| Symbol | Description |
|---|---|
|  | DANGER indicates a hazard with a high level of risk which, if not avoided, will result in death or serious injury. |
|  | WARNING indicates a hazard with a medium level of risk which, if not avoided, could result in death or serious injury. |
|  | CAUTION indicates a hazard with a low level of risk which, if not avoided, could result in minor or moderate injury. |
|  | CAUTION used without the <i>Caution, risk of danger</i> sign  , indicates a hazard with a potentially hazardous situation which, if not avoided, may result in property damage. |
|  | Caution, risk of electric shock |
|  | Caution, hot surface |
|  | Caution, risk of danger |
|  | Caution, lifting hazard |
|  | Caution, hand entanglement hazard |
|  | Notice, non-ionizing radiation |
|  | Direct current |
|  | Alternating current |
|  | Both direct and alternating current |
|  | Three-phase alternating current |
|  | Earth (ground) terminal |

Safety and Common Symbols


 


 


 
| Symbol | Description |
|--|--|
|  | Protective conductor terminal |
|  | Frame or chassis terminal |
|  | Equipotentiality |
|  | On (supply) |
|  | Off (supply) |
|  | Equipment protected throughout by double insulation or reinforced insulation |
|  | In position of a bi-stable push control |
|  | Out position of a bi-stable push control |

Table of Contents

| | |
|---|-----------|
| Preface | IX |
| About This Manual | XI |
| To the Instructor | XIII |
| Unit 1 AC Drives..... | 1 |
| DISCUSSION OF FUNDAMENTALS..... | 1 |
| Motor speed | 2 |
| Ex. 1-1 AC Drive Overview | 3 |
| DISCUSSION | 3 |
| Keypad | 5 |
| Input and output terminals | 6 |
| Microswitches..... | 7 |
| Parameters..... | 7 |
| Setting the value of a parameter | 9 |
| Reading the current setting of a parameter | 9 |
| Quick parameter selection | 9 |
| Initialization procedure (restoring default settings) | 10 |
| PROCEDURE | 10 |
| Set up and connections | 10 |
| Parameter settings | 11 |
| Initialization procedure | 12 |
| Basic motor control functions..... | 12 |
| Quick parameter selection | 14 |
| Ex. 1-2 Volts per Hertz Characteristics | 17 |
| DISCUSSION | 17 |
| Direction of rotation | 17 |
| V/f characteristics..... | 17 |
| Frequency reference selection..... | 19 |
| PROCEDURE | 19 |
| Set up and connections | 19 |
| Direction of rotation | 20 |
| V/f characteristics..... | 25 |
| Ex. 1-3 Ramp and Torque Boost..... | 29 |
| DISCUSSION | 29 |
| Acceleration and deceleration times | 29 |
| Acceleration and deceleration patterns..... | 30 |
| Torque boost | 31 |

Table of Contents

| | | |
|----------------|--|-----------|
| | PROCEDURE | 32 |
| | Set up and connections..... | 32 |
| | Acceleration and deceleration ramps..... | 32 |
| | Acceleration characteristic | 34 |
| | Torque boost | 38 |
| Ex. 1-4 | Protection | 43 |
| | DISCUSSION | 43 |
| | Limiting motor current | 44 |
| | Overload alarm signal | 45 |
| | Overvoltage during deceleration | 45 |
| | Multi-function output..... | 45 |
| | PROCEDURE | 46 |
| | Set up and connections..... | 46 |
| | Limiting motor current | 47 |
| | Overload alarm signal | 51 |
| | Overvoltage during deceleration | 52 |
| Ex. 1-5 | Braking and Jogging | 55 |
| | DISCUSSION | 55 |
| | DC braking | 55 |
| | Jog mode | 56 |
| | Multi-function inputs | 57 |
| | PROCEDURE | 58 |
| | Set up and connections..... | 58 |
| | DC braking | 59 |
| | Jog mode | 61 |
| Ex. 1-6 | Remote Controls | 65 |
| | PROCEDURE | 65 |
| | Set up and connections..... | 65 |
| | Project description..... | 65 |
| | Tips..... | 66 |
| | Equipment selection..... | 66 |
| | Schematic diagram of the circuit..... | 68 |
| | Circuit setup | 69 |
| | AC Drive parameter values | 70 |
| | Circuit approval | 70 |
| Unit 2 | DC Drives..... | 75 |

Table of Contents

| | | |
|-------------------|--|------------|
| Ex. 2-1 | DC Drive Overview | 77 |
| | DISCUSSION | 77 |
| | Input and output terminals | 78 |
| | Parameters..... | 78 |
| | Minimum speed..... | 79 |
| | Maximum speed..... | 79 |
| | Procedure Summary | 79 |
| | PROCEDURE | 79 |
| | Set up and connections | 79 |
| | Minimum speed..... | 81 |
| | Maximum speed..... | 81 |
| | Speed versus voltage characteristic | 81 |
| | Additional speed settings | 84 |
| | Direction of rotation | 84 |
| Ex. 2-2 | Current Limiting and IR Compensation | 87 |
| | DISCUSSION | 87 |
| | Current limiting | 87 |
| | IR compensation | 87 |
| | PROCEDURE | 88 |
| | Set up and connections | 88 |
| | Current limiting | 89 |
| | IR compensation | 90 |
| Appendix A | Equipment Utilization Chart | 95 |
| Appendix B | Diagram Symbols | 97 |
| Appendix C | Setup Procedures..... | 99 |
| | Module installation procedure | 99 |
| | Energizing procedure | 100 |
| | Module identification | 100 |
| Appendix D | AC Drive – Error Codes and Parameter Numbers..... | 101 |
| | Bibliography | 119 |

Preface

The Motor Drives (Add-On to Models 8001 or 8006), Model 8036-B, introduces the use of the AC and DC drives to control electric motors.

We hope that your learning experience will be the first step of a successful career.

We invite readers of this manual to send us their tips, feedback, and suggestions for improving the book.

Please send these to did@de.festo.com.

The authors and Festo Didactic look forward to your comments.

About This Manual

The exercises in this manual provide the knowledge necessary to perform motor controls with the help of motor drives.

The present manual is divided into two units:

- Unit 1 introduces the AC Drive and its main functions;
- Unit 2 introduces the DC Drive and its main functions.

Each unit contains exercises which provide a systematic and realistic means of learning the subject matter. Each exercise is divided into the following sections:

- A clearly defined Exercise Objective;
- A Discussion of the theory involved in the exercise;
- A Procedure Summary which provides a bridge between the theoretical Discussion and the laboratory Procedure;
- A step-by-step laboratory Procedure in which the students observe and quantify important principles covered in the Discussion;
- A Conclusion to summarize the material presented in the exercise;
- Review Questions to verify that the material has been well assimilated.

A ten-question test at the end of each unit allows the student's knowledge of the unit material to be assessed.

Safety considerations

Safety symbols that may be used in this manual and on the Lab-Volt equipment are listed in the Safety Symbols table at the beginning of the manual.

Safety procedures related to the tasks that you will be asked to perform are indicated in each exercise.

Make sure that you are wearing appropriate protective equipment when performing the tasks. You should never perform a task if you have any reason to think that a manipulation could be dangerous for you or your teammates.

Prerequisite

Before performing an exercise, you should have read the pages of the AC Drive, or DC Drive, user manuals that deal with the covered topics. Ask your instructor for a copy, or download the file from the manufacturer's website.

Systems of units

Units are expressed using the International System of Units (SI) followed by the units expressed in the U.S. customary system of units (between parentheses).

To the Instructor

You will find in this Instructor Guide all the elements included in the Student Manual together with the answers to all questions, results of measurements, graphs, explanations, suggestions, and, in some cases, instructions to help you guide the students through their learning process. All the information that applies to you is placed between markers and appears in red.

Accuracy of measurements

The numerical results of the hands-on exercises may differ from one student to another. For this reason, the results and answers given in this manual should be considered as a guide. Students who correctly performed the exercises should expect to demonstrate the principles involved and make observations and measurements similar to those given as answers.

Notes to the instructor

- Before a student begins an exercise, ensure that the equipment is in good condition and does not represent any risk when used.
- This guide provides you with the answers to questions.
- Make sure that the students understand the objectives of the work to do.
- The default setting of some parameters depends on the Country parameter of the AC Drive. For this reason, the default setting values shown in the user guide may differ from the current default settings of the AC Drive.

Sample Exercise
Extracted from
the Student Manual
and the Instructor Guide

Ramp and Torque Boost

EXERCISE OBJECTIVE

In this exercise, you will:

- Understand the acceleration and deceleration time settings.
- Introduce the linear and S-shape acceleration and deceleration patterns.
- Introduce the Torque boost function.

DISCUSSION OUTLINE

The Discussion of this exercise covers the following points:

- Acceleration and deceleration times
- Acceleration and deceleration patterns
- Torque boost

DISCUSSION

Acceleration and deceleration times

The acceleration time defines the time duration in which the AC Drive reaches its maximum frequency after a start signal is issued. Short acceleration times are usually for light loads, and long acceleration times for heavy loads, or in applications requiring soft start such as a bottle conveyor. The Acceleration time function is also known as ramping. See Figure 1-10.

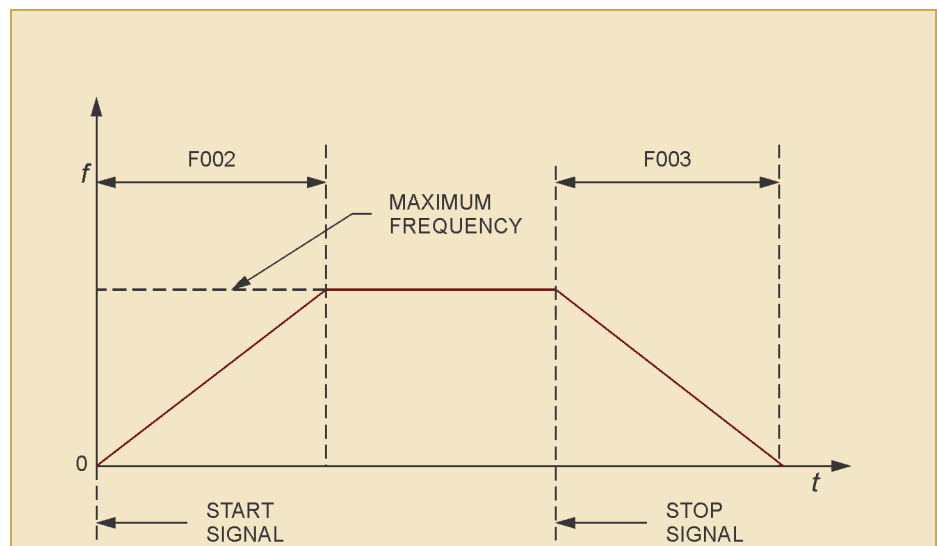


Figure 1-10. Acceleration/deceleration ramps.

Conversely, the deceleration time defines the time duration in which the AC Drive reduces the output frequency from the maximum frequency to 0 Hz after a stop signal. If the equipment connected to a motor has low friction and a lot of inertia,

it could coast for a long time. The Deceleration time function allows the load to be stopped more quickly.

The *Acceleration time* and *Deceleration time* functions are set using parameters F002 and F003. The characteristics of these parameters are shown in Table 1-8.

Table 1-8. Characteristics of parameters F002, F003, A097, and A098.

| Parameter | Function | Value | DS |
|-----------|---------------------------------------|-------------------------------|-------|
| F002 | <i>Acceleration time</i> | 0.01 to 3000 s | 10.00 |
| F003 | <i>Deceleration time</i> | 0.01 to 3000 s | 10.00 |
| A097 | <i>Acceleration pattern selection</i> | 00: Line 01: S-shape curve | 00 |
| A098 | <i>Deceleration pattern selection</i> | 00: Line 01: S-shape curve | 00 |

Acceleration and deceleration patterns

The acceleration and deceleration patterns can be linear or S shape. When a motor is started or stopped using the linear acceleration or deceleration pattern, its rate of change until it reaches full speed, or comes to a complete stop, is linear. See Figure 1-11.

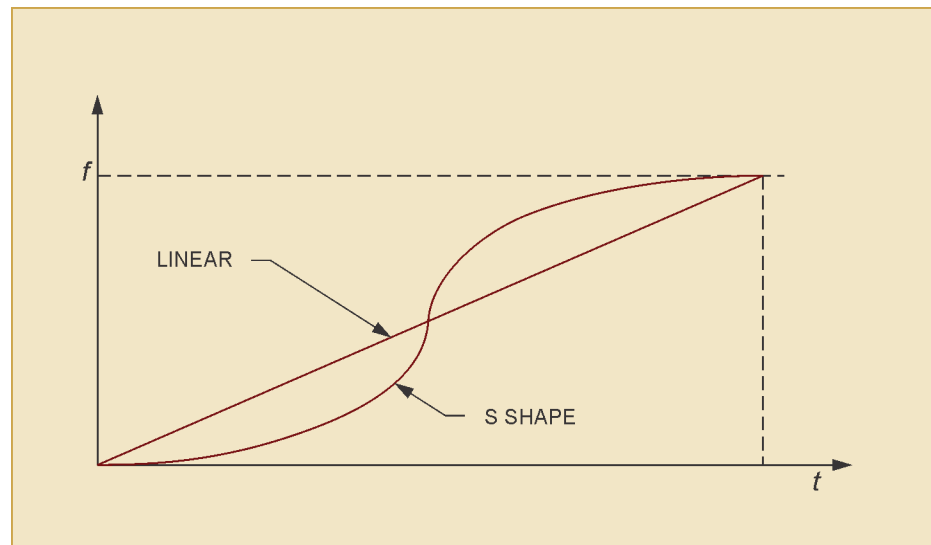


Figure 1-11. Linear and S-shape patterns during acceleration.

When the motor is started or stopped, using the S-shape acceleration or deceleration pattern, its rate of change gradually increases or decreases until it reaches full speed, or comes to a complete stop. The purpose of the S-shape pattern is to combine soft starts and soft stops with high speeds between them. The movement of an elevator is an example of the S-shape acceleration/deceleration pattern.

The *Acceleration time* and *Deceleration time* functions are set using parameters A097 and A098. The characteristics of these parameters are shown in Table 1-8.

Torque boost

If the mass inertia moment or static friction of the connected load is high, it may be necessary to increase (boost) the output voltage beyond the normal V/f characteristics at low output frequencies. This compensates for the voltage drop in the motor windings and can be up to half of the motor's nominal voltage.

The torque boost (voltage increase) is defined as a percentage value. As Figure 1-12 shows, the *Manual torque boost voltage* function (parameter A042) is a percentage of the output voltage and the *Manual torque boost frequency* function (A043) is a percentage of the frequency.

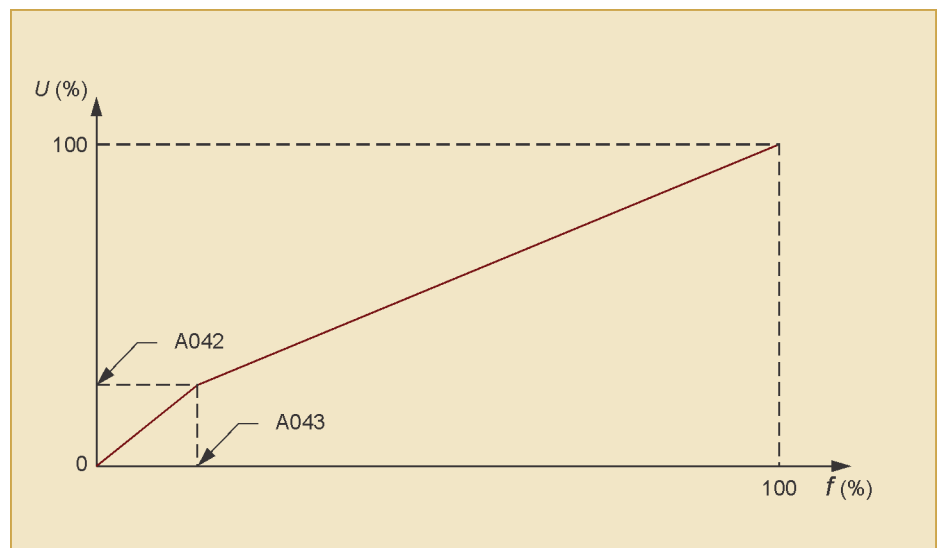


Figure 1-12. Torque boost.

The *Torque boost selection* function (parameter A041), lets you select between manual and automatic torque boost. Automatic torque boost is added to the V/f characteristics depending on the current load.

The torque boost functions are set using parameters A041, A042 and A043. The characteristics of these parameters are shown in Table 1-9.

Table 1-9. Characteristics of parameters A041, A042, and A043.

| Parameter | Function | Value | DS |
|-----------|--------------------------------------|-----------------------------|-----|
| A041 | <i>Torque boost selection</i> | 00: Manual 01: Automatic | 00 |
| A042 | <i>Manual torque boost voltage</i> | 0 to 20 % of output voltage | 5.0 |
| A043 | <i>Manual torque boost frequency</i> | 0 to 50 % of base frequency | 2.5 |

PROCEDURE OUTLINE

The Procedure is divided into the following sections:

- Set up and connections
- Acceleration and deceleration ramps
- Acceleration characteristic
- Torque boost

PROCEDURE

Set up and connections

In this section, you will setup the AC Drive.



The AC Power Supply provides high voltages. Do not change any AC connection with the power on.

1. Set up the circuit shown in Figure 1-8.

Acceleration and deceleration ramps

In this section, you will familiarize yourself with the setting of the acceleration and deceleration times.

2. Connect a voltmeter between terminals FV and FC on the AC Drive.

Perform the Energizing procedure.

Turn on the Power Supply and set the voltage control knob to 100%.

3. Set the parameters of the AC Drive as follows:
 - Restore the default setting of the parameters by performing the Initialization procedure;
 - Select *Terminal as Frequency reference selection* function by setting parameter A001 to 01;
 - Set the AC Drive to display the output voltage by selecting parameter d013.

4. On the DC Drive, set the remote potentiometer to obtain 10.0 V dc on the voltmeter display.

Determine the acceleration time by starting a chronometer as you set the AC Drive to the run mode, and stopping it when the data display indicates 90% of your local network voltage. Repeat the measurement to validate your result.

Acceleration time = _____

Acceleration time = 10 s

5. Does this correspond to the default setting of the *Acceleration time* function (parameter F002)?

Yes No

Yes

6. Set the AC Drive to the run mode and wait for the motor to attain maximum speed.

Determine the deceleration time by starting a chronometer as you set the AC Drive to the stop mode, and stopping it when the data display indicates 0 V. Repeat the measurement to validate your result.

Deceleration time = _____

Deceleration time = 10 s

7. Does this correspond to the default setting of the *Deceleration time* (F003)?

Yes No

Yes

8. Familiarize yourself with the setting of the acceleration and deceleration times by setting a 20.00 s acceleration time and a 15.00 s deceleration time.

Test the operation of your circuit.

9. Turn off the Power Supply.

Acceleration characteristic


In this section, you will plot the linear and S-shape acceleration patterns.

- Couple the dynamometer with the Four-Pole Squirrel-Cage Induction Motor using a Timing Belt.



Depending on which training system you are using, your dynamometer is either the Four-Quadrant Dynamometer/Power Supply, Model 8960-B, the Prime Mover / Dynamometer, Model 8960-1, or the Electrodynamometer, Model 8911.

Turn the load control knob on the dynamometer fully CCW (min load).

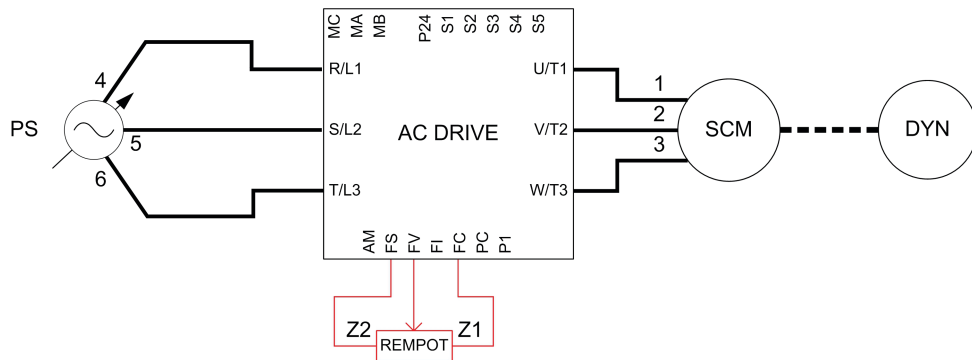

LEGEND

- AC DRIVE = AC DRIVE
- DYN = DYNAMOMETER
- REMPOT = REMOTE POTENTIOMETER (DC DRIVE POTENTIOMETER)
- SCM = SQUIRREL CAGE MOTOR (BRAKE MOTOR)
- PS = POWER SUPPLY

Figure 1-13. Couple a dynamometer with the Four-Pole Squirrel-Cage Induction Motor.

- Turn on the Power Supply.

On the DC Drive, set the remote potentiometer to obtain 10.0 V dc on the voltmeter display.

Set the *Acceleration time* to 30 s by setting parameter F002 to 30.00.

Make sure that the *Acceleration pattern selection* function (A097) is set to Line.

Set the AC Drive to display the output frequency by selecting parameter d001.

12. Set the AC Drive to the run mode and wait for the motor to run at full speed (30 s).

Set the load control knob on the dynamometer to 1 N·m (9 lbf·in).



This setting is required to apply a predetermined load to the Four-Pole Squirrel-Cage Induction Motor.

Set the AC Drive to the stop mode.

13. Measure the time taken by the AC Drive to attain 10 Hz by starting the chronometer as you set the AC Drive to the run mode, and stopping it when the AC Drive indicates 10 Hz. Repeat the measurement to validate your result.

Enter your result in the appropriate cell in the Linear column in Table 1-10.

Set the AC Drive to the stop mode.

Table 1-10. Linear and S-shape acceleration patterns.

| Frequency range | Time (s) | |
|-------------------------------|----------------------|---------|
| | Acceleration pattern | |
| | Linear | S-shape |
| 0 to 10 Hz | | |
| 0 to 20 Hz | | |
| 0 to 30 Hz | | |
| 0 to 40 Hz | | |
| 0 to 50 Hz | | |
| 0 to 60 Hz (if applicable) | | |

Linear and S-shape acceleration patterns (120 V – 60 Hz network).

| Frequency range | Time (s) | |
|-----------------|----------------------|---------|
| | Acceleration pattern | |
| | Linear | S-shape |
| 0 to 10 Hz | 5.0 | 7.2 |
| 0 to 20 Hz | 10.0 | 11.5 |
| 0 to 30 Hz | 15.0 | 15.0 |
| 0 to 40 Hz | 20.0 | 18.5 |
| 0 to 50 Hz | 25.0 | 22.8 |
| 0 to 60 Hz | 30.0 | 30.0 |

Linear and S-shape acceleration patterns (220/240 V – 50 Hz network).

| Frequency range | Time (s) | |
|-----------------|----------------------|---------|
| | Acceleration pattern | |
| | Linear | S-shape |
| 0 to 10 Hz | 6.0 | 6.0 |
| 0 to 20 Hz | 12.0 | 10.0 |
| 0 to 30 Hz | 18.0 | 14.0 |
| 0 to 40 Hz | 24.0 | 22.0 |
| 0 to 50 Hz | 30.0 | 30.0 |

Linear and S-shape acceleration patterns (220 V – 60 Hz network).

| Frequency range | Time (s) | |
|-----------------|----------------------|---------|
| | Acceleration pattern | |
| | Linear | S-shape |
| 0 to 10 Hz | 5.0 | 6.0 |
| 0 to 20 Hz | 10.0 | 10.0 |
| 0 to 30 Hz | 15.0 | 14.0 |
| 0 to 40 Hz | 20.0 | 17.0 |
| 0 to 50 Hz | 25.0 | 22.9 |
| 0 to 60 Hz | 30.0 | 30.0 |

14. Repeat the previous measurement for all frequency ranges shown in Table 1-10.

Enter your results in the appropriate cells in the Linear column in Table 1-10.

15. Set the AC Drive to the stop mode.

Set the *Acceleration pattern selection* function (A097) to 01 to select the S-shape acceleration pattern.

Select parameter d001 to display the output frequency.

16. Repeat the measurements to fill out the empty cells of Table 1-10 with the S-shape acceleration pattern.

17. Set the AC Drive to the stop mode.

18. Plot the curves showing the linear and S-shape acceleration patterns in Figure 1-14. Place the Time values along the X-axis, and the Frequency values along the Y-axis.

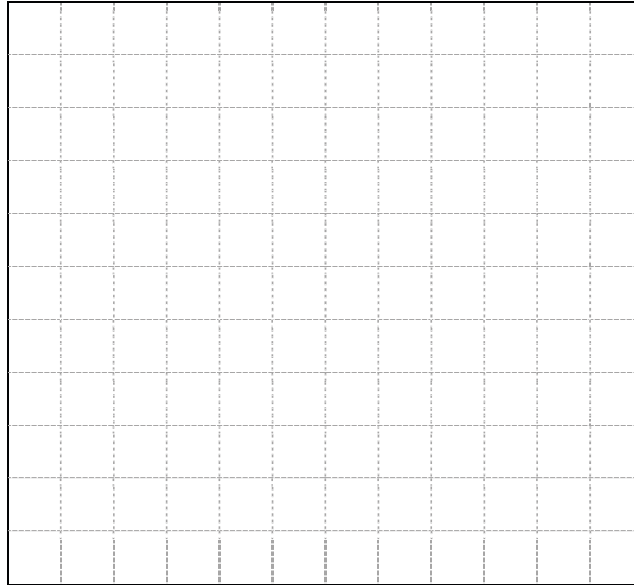


Figure 1-14. Linear and S-shape acceleration patterns.

19. Do your observations confirm that the S-shape acceleration pattern allows you a motor to be started slowly?

Yes No

Yes

20. Do your observations confirm the theory presented in the Discussion of this exercise?

Yes No

Yes

21. Set the *Acceleration pattern selection* function to Line by setting parameter A097 to 00.

Torque boost

In this section, you will observe the torque boost characteristics. You will plot the output voltage versus output frequency curve with and without torque boost.

- 22.** Make sure that the *Torque boost selection* function is set to Manual torque boost (parameter A041 = 00).

Set the *Manual torque boost voltage* function to 0% by setting parameter A042 to 0.

Set the *Manual torque boost frequency* function to 33% by setting parameter A043 to 33.

Set the AC Drive to display the output frequency by selecting parameter d001.

On the DC Drive, set the potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 23.** For all voltage setpoint values shown in Table 1-11, determine the corresponding output frequency displayed on the data display of the AC Drive. Enter your results in the appropriate cells in Table 1-11.

Table 1-11. Torque boost characteristics.

| Setpoint | | Output voltage (V) | |
|-------------|--------|----------------------|-------------------|
| Voltage (V) | f (Hz) | Without torque boost | With torque boost |
| 1 | | | |
| 2 | | | |
| 3 | | | |
| 4 | | | |
| 5 | | | |
| 6 | | | |
| 7 | | | |
| 8 | | | |
| 9 | | | |
| 10 | | | |

Torque boost characteristics (120 V – 60 Hz network).

| Setpoint | | Output voltage (V) | |
|-------------|--------|----------------------|-------------------|
| Voltage (V) | f (Hz) | Without torque boost | With torque boost |
| 1 | 6 | 23 | 37 |
| 2 | 12 | 47 | 76 |
| 3 | 18 | 71 | 115 |
| 4 | 24 | 95 | 135 |
| 5 | 30 | 119 | 153 |
| 6 | 36 | 142 | 168 |
| 7 | 42 | 166 | 186 |
| 8 | 48 | 191 | 202 |
| 9 | 54 | 204 | 204 |
| 10 | 60 | 204 | 204 |

Torque boost characteristics (220/240 V – 50 Hz network).

| Setpoint | | Output voltage (V) | |
|-------------|--------|----------------------|-------------------|
| Voltage (V) | f (Hz) | Without torque boost | With torque boost |
| 1 | 5 | 40 | 64 |
| 2 | 10 | 80 | 130 |
| 3 | 15 | 118 | 190 |
| 4 | 20 | 160 | 230 |
| 5 | 25 | 198 | 260 |
| 6 | 30 | 238 | 288 |
| 7 | 35 | 282 | 314 |
| 8 | 40 | 322 | 342 |
| 9 | 45 | 360 | 374 |
| 10 | 50 | 380 | 380 |

Torque boost characteristics (220 V – 60 Hz network).

| Setpoint | | Output voltage (V) | |
|-------------|--------|----------------------|-------------------|
| Voltage (V) | f (Hz) | Without torque boost | With torque boost |
| 1 | 6.0 | 38 | 66 |
| 2 | 12.0 | 80 | 130 |
| 3 | 18.0 | 120 | 192 |
| 4 | 24.0 | 160 | 232 |
| 5 | 30.0 | 200 | 260 |
| 6 | 36.0 | 240 | 286 |
| 7 | 42.0 | 280 | 316 |
| 8 | 48.0 | 322 | 344 |
| 9 | 54.0 | 360 | 374 |
| 10 | 60.0 | 380 | 380 |

24. Set the AC Drive to the stop mode.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the remote potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

25. For all voltage setpoint values shown in Table 1-11, determine the corresponding output voltage displayed on the data display of the AC Drive. Enter your results in the *Without torque boost* column in Table 1-11.

26. Set the AC Drive to the stop mode.

Set the *Manual torque boost voltage* function to 20% by setting parameter A042 to 20.

Set the AC Drive to display the output voltage by selecting parameter d013.

Set the remote potentiometer to obtain 0.0 V dc on the voltmeter display.

Set the AC Drive to the run mode.

- 27. For all voltage setpoint values shown in Table 1-11, determine the corresponding output voltage displayed by the data display on the AC Drive. Enter your results in the *With torque boost* column in Table 1-11.
- 28. Set the AC Drive to the stop mode.
- 29. Plot the curves with and without torque boost in Figure 1-15. Place the Frequency values along the X-axis, and the Output voltage values along the Y-axis.

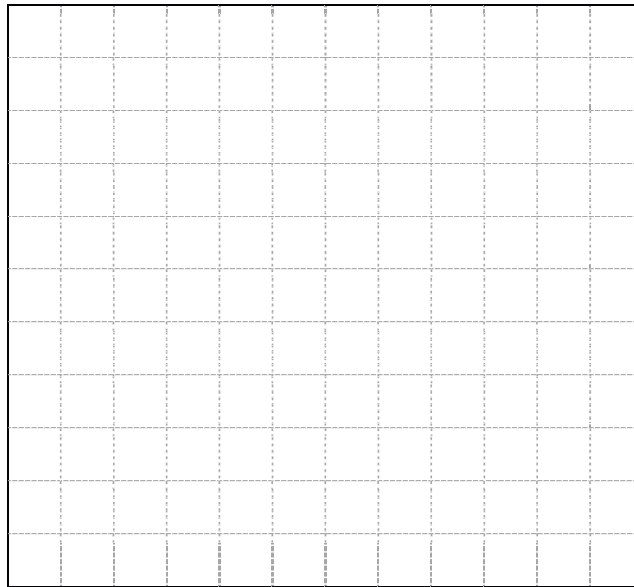


Figure 1-15. With and without torque boost characteristics.

- 30. At what frequency is the torque boost maximum?

Frequency where the torque boost is maximum = _____

33% of the base frequency.

- 31. Does the torque boost correspond to approximately 20% the output voltage at that frequency (33% of the base frequency)?

Yes No

Yes

- 32. Turn off the Power Supply, disconnect the circuit, and return the equipment to the storage location.

CONCLUSION

In this exercise, you familiarized yourself with the acceleration and deceleration time settings. You plotted the curves showing the line and S-shape acceleration patterns.

You also experimented with the Torque boost function. You saw that it is possible to increase the voltage at a particular frequency to compensate for the voltage drop in the motor windings.

REVIEW QUESTIONS

1. Applications requiring slow start usually have

- a. short acceleration time.
- b. long acceleration time.
- c. short deceleration time.
- d. long deceleration time.

b

2. The purpose of an S-shape acceleration pattern is

- a. to combine soft starts and stops with high speeds when moving from a point to another.
- b. to combine rapid starts and stops with high speeds when moving from a point to another.
- c. to combine rapid starts and stops with low speeds when moving from a point to another.
- d. to combine soft starts and stops with low speeds when moving from a point to another.

a

3. Torque boost is applied at

- a. high frequencies.
- b. low frequencies.
- c. frequencies required by the load.
- d. None of the answers above is correct.

b

4. Torque boost is applied

- a. when the mass inertia moment of the connected load is high.
- b. to compensate for the voltage drop in the motor windings.
- c. beyond the normal V/f characteristic.
- d. All of the answers above are correct.

d

Bibliography

Peck, Jeff, *Foundation Engineering*, 2nd ed., New York: McGraw-Hill, 1972, pp. 230-292, ISBN 0-227-10403-6.

McMillan, G. K., and Cameron, R. A., *Advanced pH Measurement and Control*, 3rd ed., NC: ISA, 2005, ISBN 0-07-100793-8.