




Description of the problem

The state of the contactor on the Synchronizing Module / Three-Phase Contactor, Model 8621-Ax, may be unstable when activated using the remote control input, particularly in a noisy environment.

How to fix

Resistor R7 (refer to figure below) on the PCB needs to be replaced. The value of the replacement resistor is 200 Ω , 1/4 W.

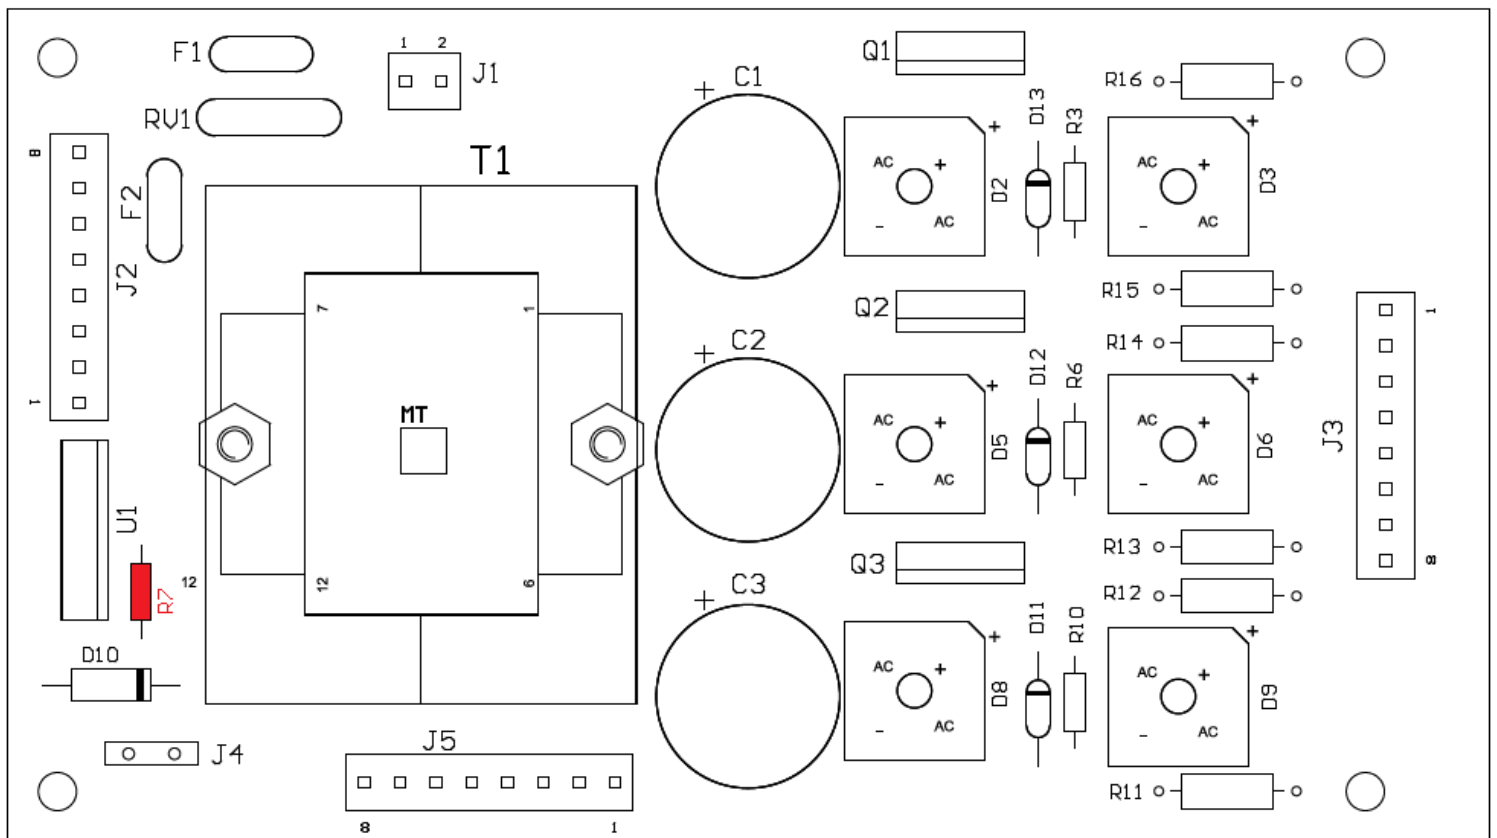

For further assistance, please contact customer services at: services.didactic@festo.com